



Intel[®] Pentium[®] 4 Processor Specification Update

Release Date: November 2002

Order Number: 249199-029

The Intel[®] Pentium[®] 4 processor may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are documented in this Specification Update.

INFORMATION IN THIS DOCUMENT IS PROVIDED IN CONNECTION WITH INTEL® PRODUCTS. NO LICENSE, EXPRESS OR IMPLIED, BY ESTOPPEL OR OTHERWISE, TO ANY INTELLECTUAL PROPERTY RIGHTS IS GRANTED BY THIS DOCUMENT. EXCEPT AS PROVIDED IN INTEL'S TERMS AND CONDITIONS OF SALE FOR SUCH PRODUCTS, INTEL ASSUMES NO LIABILITY WHATSOEVER, AND INTEL DISCLAIMS ANY EXPRESS OR IMPLIED WARRANTY, RELATING TO SALE AND/OR USE OF INTEL PRODUCTS INCLUDING LIABILITY OR WARRANTIES RELATING TO FITNESS FOR A PARTICULAR PURPOSE, MERCHANTABILITY, OR INFRINGEMENT OF ANY PATENT, COPYRIGHT OR OTHER INTELLECTUAL PROPERTY RIGHT. Intel products are not intended for use in medical, life saving, or life sustaining applications.

Intel may make changes to specifications and product descriptions at any time, without notice.

Designers must not rely on the absence or characteristics of any features or instructions marked "reserved" or "undefined." Intel reserves these for future definition and shall have no responsibility whatsoever for conflicts or incompatibilities arising from future changes to them.

The Intel® <product name> may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are available on request.

Contact your local Intel sales office or your distributor to obtain the latest specifications and before placing your product order.

Intel, Intel logo, Pentium, and MMX are trademarks or registered trademarks of Intel Corporation or its subsidiaries in the United States and other countries.

*Other names and brands may be claimed as the property of others.

Copyright © 2000-2002, Intel Corporation

CONTENTS

REVISION HISTORY	ii
PREFACE	iv
IDENTIFICATION INFORMATION	4
SUMMARY OF CHANGES.....	11
Summary of Errata.....	12
Summary of Documentation Changes.....	16
Summary of Specification Clarifications	17
Summary of Specification Changes.....	18
ERRATA.....	19
DOCUMENTATION CHANGES.....	45
Opcode Instruction Description.....	48
SPECIFICATION CLARIFICATIONS.....	72
SPECIFICATION CHANGES.....	72
IA32_MISC_ENABLE – Miscellaneous Enables Register, bit # 24	74

REVISION HISTORY

Date of Revision	Version	Description
November 2000	-001	Initial Release
December 2000	-002	Added errata numbers N41-N44.
January 2001	-003	Updated Intel® Pentium® 4 Processor Identification Information. Updated erratum N40. Added errata N45 through N46.
February 2001	-004	Added errata N47.
March 2001	-005	Updated the processor identification information table. Removed <i>Possible system hang due to cacheable line-split loads with page-tables in uncacheable (UC) space</i> and <i>Uncacheable memory type prevents physical address code breakpoint match</i> erratum. Renumbered remaining errata. Modified the workaround for N45. Added errata N46 and N47. Added processor marking information.
March 2001	-006	Updated plans column for errata N6, N7, N10, N11, N14, N18, N19, N21, N23 – N28, N30 – N35, and N41
April 2001	-007	Added information for the Intel® Pentium® 4 processor in the 478-pin package. Added erratum N48.
May 2001	-008	Updated the Intel® Pentium® 4 Processor Identification Information table. Added erratum N49.
June 2001	-009	Updated Specification Update product key to include the Intel® Xeon™ processor. Updated erratum N45, added erratum N50 and Specification Change N1.
July 2001	-010	Added errata N51 and Specification Clarification N1. Updated Intel® Pentium® 4 Processor Identification Information table.
August 2001	-011	Added errata N52 and N53 and Specification Clarification N2.
August 2001	-012	Release for launch of new frequencies and the 478-pin package. Updated Intel® Pentium® 4 Processor Identification Information table.
September 2001	-013	Added errata N54 -- N56.
October 2001	-014	Added erratum N57. Added Specification Clarification N3. Updated Intel® Pentium® 4 Processor Identification Information table.
November 2001	-015	Added Documentation Changes N1 and N2.
December 2001	-016	Added erratum N58 and Documentation Change N3.
January 2002	-017	Added Intel® Pentium® 4 Processor with 512KB cache in .13 micron process information.
January 2002	-018	Added Documentation Change N4.
February 2002	-019	Added errata N60 and N61.

REVISION HISTORY

Date of Revision	Version	Description
March 2002	-020	Added Documentation Change N5
April 2002	-021	Added errata N62 and N63. Removed Documentation Changes, Specification Clarifications, and Specification Changes that have been incorporated into documentation. Added Specification Clarifications N1 – N5.
May 2002	-022	Updated erratum N37. Added errata N64. Added Specification Change N1 to N3. Removed Documentation Changes that have been incorporated into the documentation. Added Documentation Changes N1 and N2.
June 2002	-023	Added erratum N65. Removed Documentation Changes that have been incorporated into the documentation. Added Documentation Change N1 and N2.
July 2002	-024	Added erratum N66. Removed Documentation Changes that have been incorporated into the documentation. Added Documentation Changes N3 to N12.
August 2002	-025	Removed Documentation Changes that have been incorporated into the documentation.
August 2002	-026	Added 2.80 GHz and C1 stepping information.
September 2002	-027	Updated erratum N39. Added Documentation Changes N3 to N24.
October 2002	-028	Added erratum N67. Added Documentation Changes N25 to N32.
November 2002	-029	Added Package Markings under General Information. Added Errata N68. Added Specification Clarification N1. Added Specification Changes N3 and N4. Added Documentation Changes N33 – N42.



PREFACE

This document is an update to the specifications contained in the following document:

- *Intel Architecture Software Developer's Manual, Volumes 1, 2, and 3* (Order Numbers 243190, 243191, and 243192, respectively)
- *Intel® Pentium® 4 Processor in the 423-pin Package* datasheet
- *Intel® Pentium® 4 Processor in the 478-pin Package* datasheet
- *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet

It is intended for hardware system manufacturers and software developers of applications, operating systems, or tools. It contains S-Specs, Errata, Documentation Changes, Specification Clarifications and Specification Changes.

Nomenclature

S-Spec Number is a five-digit code used to identify products. Products are differentiated by their unique characteristics, e.g., core speed, L2 cache size, package type, etc. as described in the processor identification information table. Care should be taken to read all notes associated with each S-Spec number.

Errata are design defects or errors. Errata may cause the Intel Pentium 4 processor's behavior to deviate from published specifications. Hardware and software designed to be used with any given processor must assume that all errata documented for that processor are present on all devices unless otherwise noted.


Documentation Changes include typos, errors, or omissions from the current published specifications. These changes will be incorporated in the next release of the specifications.

Specification Clarifications describe a specification in greater detail or further highlight a specification's impact to a complex design situation. These clarifications will be incorporated in the next release of the specifications.


Specification Changes are modifications to the current published specifications for the Intel Pentium 4 processor. These changes will be incorporated in the next release of the specifications.


GENERAL INFORMATION

Pentium 4 Processor in the 423-pin Package and Boxed Pentium 4 Processor in the 423-pin Package Markings


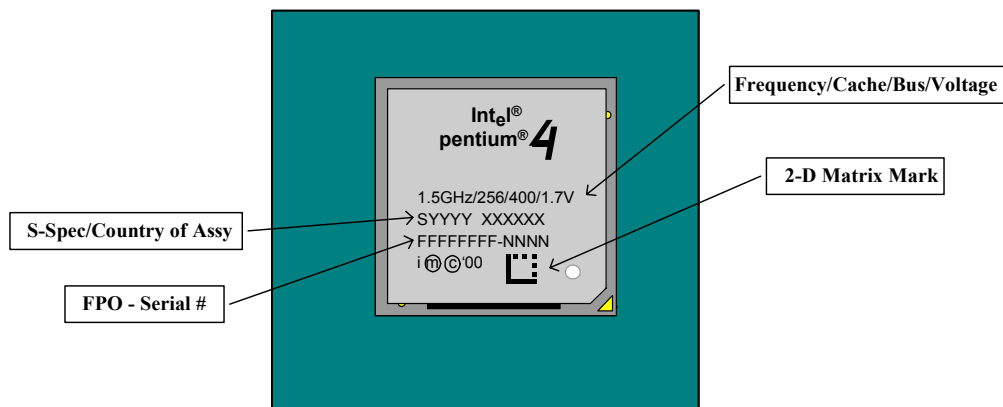


Pentium 4 Processor in the 478-pin Package and Boxed Pentium 4 Processor in the 478-pin Package Markings

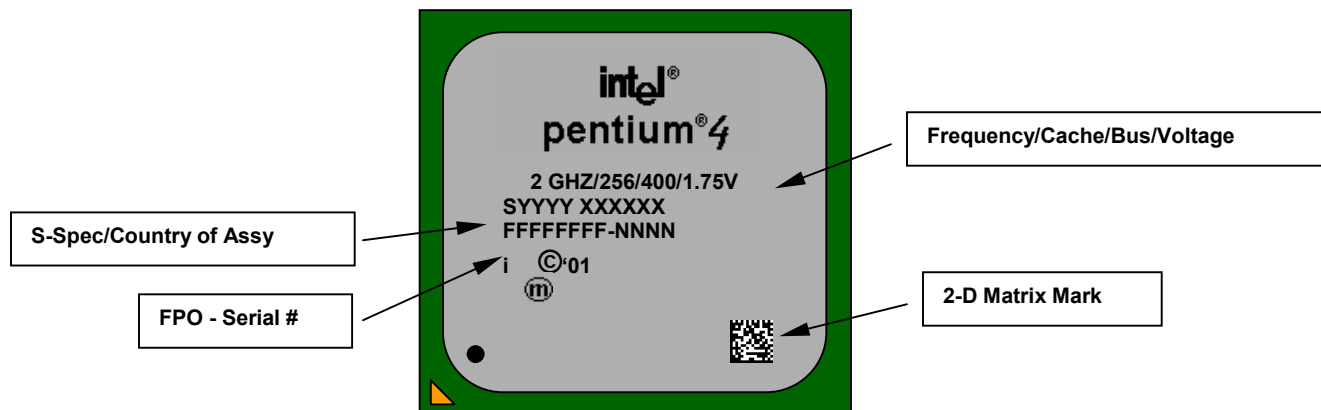

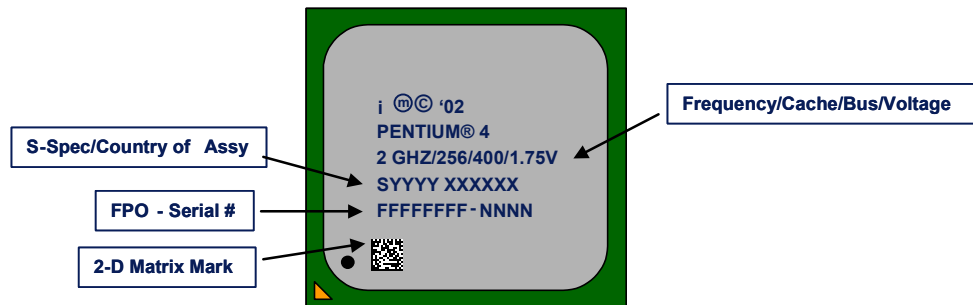

Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process and Boxed Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process Processor Markings

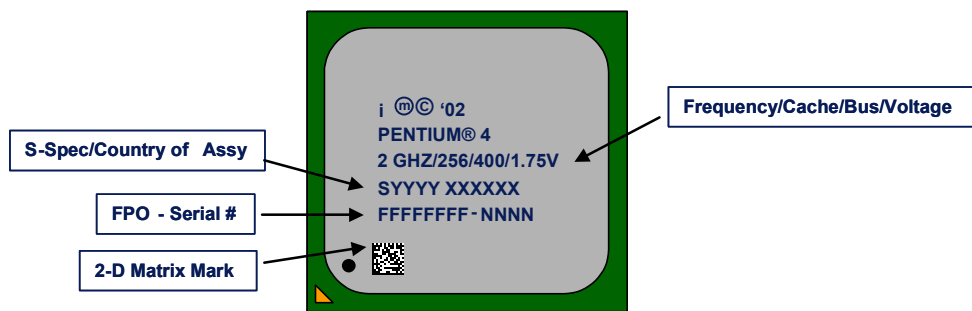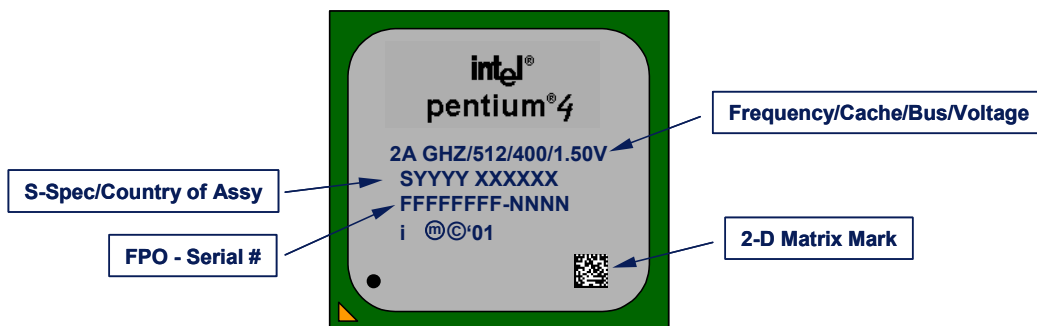



IDENTIFICATION INFORMATION

The Intel® Pentium® 4 processor can be identified by the following values:

Family ¹	Model ²	Brand ID ³
1111	0000	00001000
1111	0001	00001000 or 00001001
1111	0010	00001001

NOTES:

1. The Family corresponds to bits [11:8] of the EDX register after RESET, bits [11:8] of the EAX register after the CUID instruction is executed with a 1 in the EAX register, and the generation field of the Device ID register accessible through Boundary Scan.
2. The Model corresponds to bits [7:4] of the EDX register after RESET, bits [7:4] of the EAX register after the CUID instruction is executed with a 1 in the EAX register, and the model field of the Device ID register accessible through Boundary Scan.
3. The Brand ID corresponds to bits [7:0] of the EBX register after the CUID instruction is executed with a 1 in the EAX register.



Intel® Pentium® 4 Processor Identification Information

S-Spec	Core Stepping	L2 Cache Size (bytes)	CPUID	Speed Core/Bus	Package and Revision	Notes
SL4QD	B2	256K	0F07h	1.30GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL4SF	B2	256K	0F07h	1.30GHz/400MHz	31.0 mm OOI rev 1.0	3
SL4SG	B2	256K	0F07h	1.40GHz/400MHz	31.0 mm OOI rev 1.0	2, 3
SL4SC	B2	256K	0F07h	1.40GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL4SH	B2	256K	0F07h	1.50GHz/400MHz	31.0 mm OOI rev 1.0	2, 3
SL4TY	B2	256K	0F07h	1.50GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL5FW	C1	256K	0F0Ah	1.30GHz/400MHz	31.0 mm OOI rev 1.0	3
SL4WS	C1	256K	0F0Ah	1.40GHz/400MHz	31.0 mm OOI rev 1.0	3
SL4WT	C1	256K	0F0Ah	1.50GHz/400MHz	31.0 mm OOI rev 1.0	3
SL4WU	C1	256K	0F0Ah	1.60GHz/400MHz	31.0 mm OOI rev 1.0	3
SL57W	C1	256K	0F0Ah	1.7GHz/400MHz	31.0 mm OOI rev 1.0	2, 3
SL4WV	C1	256K	0F0Ah	1.80GHz/400MHz	31.0 mm OOI rev 1.0	3
SL5GC	C1	256K	0F0Ah	1.30GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL4X2	C1	256K	0F0Ah	1.40GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL4X3	C1	256K	0F0Ah	1.50GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL4X4	C1	256K	0F0Ah	1.60GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL57V	C1	256K	0F0Ah	1.70GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL4X5	C1	256K	0F0Ah	1.80GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL5SX	D0	256K	0F12h	1.50GHz/400MHz	31.0 mm FC rev 1.0	3
SL5VL	D0	256K	0F12h	1.60GHz/400MHz	31.0 mm FC rev 1.0	3
SL5SY	D0	256K	0F12h	1.70GHz/400MHz	31.0 mm FC rev 1.0	3



Intel® Pentium® 4 Processor Identification Information

S-Spec	Core Stepping	L2 Cache Size (bytes)	CPUID	Speed Core/Bus	Package and Revision	Notes
SL5VM	D0	256K	0F12h	1.80GHz/400MHz	31.0 mm FC rev 1.0	3
SL5VN	D0	256K	0F12h	1.90GHz/400MHz	31.0 mm FC rev 1.0	3
SL5SZ	D0	256K	0F12h	2GHz/400MHz	31.0 mm FC rev 1.0	3
SL5UL	D0	256K	0F12h	1.60GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL5VM	D0	256K	0F12h	1.80GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL5WH	D0	256K	0F12h	1.90GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL5TQ	D0	256K	0F12h	2GHz/400MHz	31.0 mm OOI rev 1.0	1, 3
SL59U	C1	256K	0F0Ah	1.40GHz/400Mhz	31.0 mm FC rev 1.0	2, 4
SL59V	C1	256K	0F0Ah	1.50GHz/400Mhz	31.0 mm FC rev 1.0	4
SL5US	C1	256K	0F0Ah	1.60GHz/400MHz	31.0 mm FC rev 1.0	4
SL59X	C1	256K	0F0Ah	1.70GHz/400Mhz	31.0 mm FC rev 1.0	4
SL5UT	C1	256K	0F0Ah	1.80GHz/400MHz	31.0 mm FC rev 1.0	4
SL5VK	D0	256K	0F12h	1.90GHz/400MHz	31.0 mm FC rev 1.0	4
SL5TG	D0	256K	0F12h	1.40GHz/400MHz	31.0 mm FC rev 1.0	2, 4
SL5TJ	D0	256K	0F12h	1.50GHz/400MHz	31.0 mm FC rev 1.0	2, 4
SL5VH	D0	256K	0F12h	1.60GHz/400MHz	31.0 mm FC rev 1.0	2, 4
SL5TK	D0	256K	0F12h	1.70GHz/400MHz	31.0 mm FC rev 1.0	2, 4
SL5VJ	D0	256K	0F12h	1.80GHz/400MHz	31.0 mm FC rev 1.0	2, 4
SL5VK	D0	256K	0F12h	1.90GHz/400MHz	31.0 mm FC rev 1.0	2, 4
SL5TL	D0	256K	0F12h	2GHz/400MHz	31.0 mm FC rev 1.0	4
SL5N7	C1	256K	0F0Ah	1.40GHz/400MHz	31.0 mm FC rev 1.0	1, 4



Intel® Pentium® 4 Processor Identification Information

S-Spec	Core Stepping	L2 Cache Size (bytes)	CPUID	Speed Core/Bus	Package and Revision	Notes
SL5N8	C1	256K	0F0Ah	1.50GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL5UW	C1	256K	0F0Ah	1.60GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL5N9	C1	256K	0F0Ah	1.70GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL5UV	C1	256K	0F0Ah	1.80GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL5UE	D0	256K	0F12h	1.40GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL5UF	D0	256K	0F12h	1.50GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL62Y	D0	256K	0F12h	1.50GHz/400MHz	31.0 mm FC rev 1.0	1, 4, 6
SL5UJ	D0	256K	0F12h	1.60GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL5UG	D0	256K	0F12h	1.70GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL62Z	D0	256K	0F12h	1.70GHz/400MHz	31.0 mm FC rev 1.0	1, 4, 7
SL5UK	D0	256K	0F12h	1.80GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL5WG	D0	256K	0F12h	1.90GHz/400MHz	31.0 mm FC rev 1.0	1, 4
SL668	B0	512K	0F24	1.60GHz/400MHz	31.0 mm FC rev 1.0	1, 5, 8
SL63X	B0	512K	0F24	1.80GHz/400MHz	31.0 mm FC rev 1.0	1, 5, 9
SL62P	B0	512K	0F24	1.80GHz/400MHz	31.0 mm FC rev 1.0	2, 5, 7, 9
SL68Q	B0	512K	0F24	1.80GHz/400MHz	31.0 mm FC rev 1.0	1, 5
SL68R	B0	512K	0F24	2GHz/400MHz	31.0 mm FC rev 1.0	1, 5
SL5YR	B0	512K	0F24	2GHz/400MHz	31.0 mm FC rev 1.0	2, 5
SL5YS	B0	512K	0F24	2.20GHz/400MHz	31.0 mm FC rev 1.0	2, 5
SL68S	B0	512K	0F24	2.20GHz/400MHz	31.0 mm FC rev 1.0	1, 5
SL68T	B0	512K	0F24	2.40GHz/400MHz	31.0 mm FC rev 1.0	1, 5



Intel® Pentium® 4 Processor Identification Information

S-Spec	Core Stepping	L2 Cache Size (bytes)	CPUID	Speed Core/Bus	Package and Revision	Notes
SL5ZU	B0	512K	0F24	2.20GHz/400MHz	31.0 mm FC rev 1.0	1, 5
SL65R	B0	512K	0F24	2.40GHz/400MHz	31.0 mm FC rev 1.0	2, 5
SL67R	B0	512K	0F24	2.40GHz/400MHz	31.0 mm FC rev 1.0	1, 5
SL683	B0	512K	0F24	2.26GHz/533MHz	31.0 mm FC rev 1.0	1, 5
SL67Y	B0	512K	0F24	2.26GHz/533MHz	31.0 mm FC rev 1.0	2, 5
SL684	B0	512K	0F24	2.40GHz/533MHz	31.0 mm FC rev 1.0	1, 5
SL67Z	B0	512K	0F24	2.40GHz/533MHz	31.0 mm FC rev 1.0	2, 5
SL685	B0	512K	0F24	2.53GHz/533MHz	31.0 mm FC rev 1.0	1, 5
SL682	B0	512K	0F24	2.53GHz/533MHz	31.0 mm FC rev 1.0	2, 5
SL6HL	C1	512K	0F27	2.80GHz/533Mhz	31.0 mm FC rev 1.0	5
SL6K6	C1	512K	0F27	2.80GHz/533Mhz	31.0 mm FC rev 1.0	1, 5
SL6LA	C1	512K	0F27	1.80GHz/400Mhz	31.0 mm FC rev 1.0	5
SL6GQ	C1	512K	0F27	2GHz/400Mhz	31.0 mm FC rev 1.0	5
SL6GR	C1	512K	0F27	2.2GHz/400Mhz	31.0 mm FC rev 1.0	5
SL6DU	C1	512K	0F27	2.26GHz/533Mhz	31.0 mm FC rev 1.0	5
SL6EF	C1	512K	0F27	2.40GHz/533Mhz	31.0 mm FC rev 1.0	1, 5
SL6DV	C1	512k	0F27	2.40GHz/533Mhz	31.0 mm FC rev 1.0	2, 5
SL6EG	C1	512K	0F27	2.53GHz/533Mhz	31.0 mm FC rev 1.0	1, 5
SL6DW	C1	512K	0F27	2.53GHz/533Mhz	31.0 mm FC rev 1.0	2, 5
SL6S6	C1	512K	0F27	1.80GHz/400Mhz	31.0 mm FC rev 1.0	5, 16



Intel® Pentium® 4 Processor Identification Information

S-Spec	Core Stepping	L2 Cache Size (bytes)	CPUID	Speed Core/Bus	Package and Revision	Notes
SL6S7	C1	512K	0F27	2.00GHz/400Mhz	31.0 mm FC rev 1.0	5, 16
SL6S8	C1	512K	0F27	2.20GHz/400Mhz	31.0 mm FC rev 1.0	5, 16
SL6RY	C1	512K	0F27	2.26GHz/533Mhz	31.0 mm FC rev 1.0	5, 16
SL6S9	C1	512K	0F27	2.40GHz/400Mhz	31.0 mm FC rev 1.0	5, 16
SL6RZ	C1	512K	0F27	2.40GHz/533Mhz	31.0 mm FC rev 1.0	5, 16
SL6SA	C1	512K	0F27	2.50GHz/400Mhz	31.0 mm FC rev 1.0	5, 16
SL6S2	C1	512K	0F27	2.53GHz/533Mhz	31.0 mm FC rev 1.0	5, 16
SL6SB	C1	512K	0F27	2.60GHz/400Mhz	31.0 mm FC rev 1.0	5, 16
SL6S3	C1	512K	0F27	2.66GHz/533Mhz	31.0 mm FC rev 1.0	5, 16
SL6S4	C1	512K	0F27	2.80GHz/533Mhz	31.0 mm FC rev 1.0	5, 16
SL6S5	C1	512K	0F27	3.06GHz/533Mhz	31.0 mm FC rev 1.0	5, 11, 16
SL5TN	D0	256K	0F12	1.50GHz/400Mhz	31.0 mm FC rev 1.0	1, 3
SL4X5	C1	256K	0F0	1.80GHz/400Mhz	31.0 mm FC rev 1.0	1, 3
SL6BC	E0	256K	0F13	1.60GHz/400Mhz	31.0 mm FC rev 1.0	1, 4
SL679	E0	256K	0F13	1.60GHz/400Mhz	31.0 mm FC rev 1.0	2, 4
SL6BD	E0	256K	0F13	1.70GHz/400Mhz	31.0 mm FC rev 1.0	1, 4
SL67A	E0	256K	0F13	1.70GHz/400Mhz	31.0 mm FC rev 1.0	2, 4
SL6BE	E0	256K	0F13	1.80GHz/400Mhz	31.0 mm FC rev 1.0	1, 4
SL67B	E0	256K	0F13	1.80GHz/400Mhz	31.0 mm FC rev 1.0	2, 4
SL6BF	E0	256K	0F13	1.90GHz/400Mhz	31.0 mm FC rev 1.0	1, 4

Intel® Pentium® 4 Processor Identification Information

S-Spec	Core Stepping	L2 Cache Size (bytes)	CPUID	Speed Core/Bus	Package and Revision	Notes
SL67C	E0	256K	0F13	1.90GHz/400Mhz	31.0 mm FC rev 1.0	2, 4

NOTES:

1. This is a boxed Intel Pentium 4 processor with an unattached fan heatsink.
2. Some of these processors are offered as boxed processors with an unattached fan heatsink
3. These processors are in the 423-pin package.
4. These processors are Intel® Pentium® 4 processors in the 478-pin package.
5. These processors are Intel® Pentium® 4 processors with 512KB L2 cache on .13 micron process.
6. These parts have some specifications that differ from those in the *Intel® Pentium® 4 Processor in the 478-pin Package* datasheet. The specifications that are different from the datasheet are: Vmax = 1.665 V, Vmin = 1.570 V, lcc_max = 46.1 A, TDP = 62.9 W, Tcase = 71 °C, Isgnt = 15.8 A.
7. These parts have some specifications that differ from those in the *Intel® Pentium® 4 Processor in the 478-pin Package* datasheet. The specifications that are different from the datasheet are: Vmax = 1.655 V, Vmin = 1.560 V, lcc_max = 50.2 A, TDP = 67.7 W, Tcase = 73 °C, Isgnt = 16.1 A.
8. These parts have some specifications that differ from those in the *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet. The specifications that are different from the datasheet are: Vmax= 1.425 V, Vmin=1.355 V, lcc_max = 38.8A, TDP= 46.8W, Tcase= 66C, Isgnt=17.0A.
9. These parts have some specifications that differ from those in the *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet. The specifications that are different from the datasheet are: Vmax= 1.420 V, Vmin=1.350 V, lcc_max = 41.6A, TDP= 49.6W, Tcase= 67C, Isgnt=17.1A.
10. These processors incorrectly return a Brand ID of 0Ah instead of the expected Brand ID of 09h. The Brand ID corresponds to bits [7:0] of the EBX register after the CPUID instruction is executed with a 1 in the EAX register.
11. These parts include Hyper-threading Technology.
12. These parts are at VID=1.475v.
13. These parts are at VID=1.500v.
14. These parts are at VID=1.525v.
15. These parts are at VID=1.550v.
16. These parts have multiple VIDs.

SUMMARY OF CHANGES

The following table indicates the Errata, Documentation Changes, Specification Clarifications, or Specification Changes that apply to Intel Pentium 4 processors. Intel intends to fix some of the errata in a future stepping of the component, and to account for the other outstanding issues through documentation or specification changes as noted. This table uses the following notations:

CODES USED IN SUMMARY TABLE

X:	Erratum, Documentation Change, Specification Clarification, or Specification Change applies to the given processor stepping.
(No mark) or (blank box):	This item is fixed in or does not apply to the given stepping.
PlanFix:	This erratum may be fixed in a future stepping of the product.
Fixed:	This erratum has been previously fixed.
NoFix:	There are no plans to fix this erratum.
Doc:	Document change or update that will be implemented.
PKG:	This column refers to errata on the Intel® Pentium® 4 processor substrate.
AP:	APIC related erratum.
Shaded:	This item is either new or modified from the previous version of the document.

Each Specification Update item is prefixed with a capital letter to distinguish the product. The key below details the letters that are used in Intel's microprocessor Specification Updates:

A = Intel® Pentium® II processor

B = Mobile Intel® Pentium® II processor

C = Intel® Celeron® processor

D = Intel® Pentium® II Xeon™ processor

E = Intel® Pentium® III processor

G = Intel® Pentium® III Xeon™ processor

H = Mobile Intel® Celeron® processor at 466 MHz, 433 MHz, 400 MHz, 366 MHz, 333 MHz, 300 MHz, and 266 MHz

K = Mobile Intel® Pentium® III processor - M

M = Mobile Intel® Celeron® processor at 500 MHz, 450 MHz, and 400A MHz

N = Intel® Pentium® 4 processor

O = Intel® Xeon™ processor MP

P = Intel® Xeon™ processor

T = Mobile Intel® Pentium® 4 processor - M

The Specification Updates for the Pentium® processor, Pentium® Pro processor, and other Intel products do not use this convention.

Summary of Errata

NO.	B2	C1	D0	E0	nB0	nC1	Plans	ERRATA
N1	X	X	X	X	X	X	NoFix	I/O restart in SMM may fail after simultaneous machine check exception (MCE)
N2	X	X	X	X	X	X	NoFix	MCA registers may contain invalid information if RESET# occurs and PWRGOOD is not held asserted
N3	X	X	X	X			Fixed	Uncacheable (UC) code in same line as write back (WB) data may lead to data corruption
N4	X	X	X	X	X	X	NoFix	Transaction is not retried after BINIT#
N5	X	X	X	X	X	X	NoFix	Invalid opcode 0FFFh requires a ModRM byte
N6	X						Fixed	RFO-ECC-snoop-MCA combination can result in two lines being corrupted in main memory
N7	X						Fixed	Overlap of MTRRs with the same memory type results in a type of uncacheable (UC)
N8	X	X	X	X	X	X	NoFix	FSW may not be completely restored after page fault on FRSTOR or FLDDENV instructions
N9	X	X	X	X	X	X	NoFix	The processor flags #PF instead of #AC on an unlocked CMPXCHG8B instruction
N10	X						Fixed	IERR# may not go active when an internal error occurs
N11	X						Fixed	All L2 cache uncorrectable errors are logged as data writes
N12	X	X	X	X	X	X	NoFix	When in no-fill mode the memory type of large pages are incorrectly forced to uncacheable
N13	X	X	X	X	X	X	PlanFix	Processor may hang due to speculative page walks to non-existent system memory
N14	X						Fixed	Load operations may get stale data in the presence of memory address aliasing
N15	X	X	X	X			Fixed	Writing a performance counter may result in incorrect value
N16	X	X	X	X	X	X	NoFix	IA32_MC0_STATUS register overflow bit not set correctly
N17	X	X	X	X			Fixed	Performance counter may contain incorrect value after being stopped
N18	X						Fixed	The TAP drops the last bit during instruction register shifting
N19	X						Fixed	Data breakpoints on the high half of a floating point line split may not be captured
N20	X	X	X	X			Fixed	MCA error code field in IA32_MC0_STATUS register may become out of sync with the rest of the register
N21	X						Fixed	Processor may hang on a correctable error and snoop combination
N22	X	X	X	X	X	X	NoFix	The IA32_MC1_STATUS register may contain incorrect information for correctable errors
N23	X						Fixed	MCA error incorrectly logged as prefetches

Summary of Errata

NO.	B2	C1	D0	E0	nB0	nC1	Plans	ERRATA
N24	X						Fixed	Speculative loads which hit the L2 cache and get an uncorrectable error will log erroneous information
N25	X						Fixed	Processor may fetch reset vector from cache if A20M# is asserted during init
N26	X						Fixed	A correctable error on an L2 cache shared state line hit with go to invalid snoop hangs processor
N27	X						Fixed	System hang due to uncorrectable error and bus lock combination
N28	X						Fixed	Incorrect address for an L1 tag parity error is logged in IA32_MC1_ADDR register
N29	X	X					Fixed	REP MOV instruction with overlapping source and destination may result in data corruption
N30	X						Fixed	Stale data in processor translation cache may result in hang
N31	X						Fixed	I/O buffers for FERR#, PROCHOT# and THERMTRIP# are not AGTL+
N32	X						Fixed	RFO and correctable error combination may cause lost store or hang
N33	X						Fixed	RFO and correctable error may incorrectly signal the machine check handler
N34	X						Fixed	Processor may report invalid TSS fault instead of double fault during mode C paging
N35	X						Fixed	IA32_MC0_STATUS incorrect after illegal APIC request
N36	X	X					Fixed	Thermal status log bit may not be set when the thermal control circuit is active
N37	X	X	X	X	X	X	NoFix	Debug mechanisms may not function as expected
N38	X	X	X	X	X	X	NoFix	Machine check architecture error reporting and recovery may not work as expected
N39	X	X	X	X			Fixed	Processor may Timeout Waiting for a Device to Respond after ~0.67 Seconds
N40	X	X	X	X	X	X	NoFix	Cascading of Performance Counters does not work Correctly when Forced Overflow is Enabled
N41	X						Fixed	Possible Machine Check Due to Line-Split Loads with Page-Tables in Uncacheable (UC) Space
N42	X	X	X	X			Fixed	IA32_MC1_STATUS MSR ADDRESS VALID bit may be set when no Valid Address is Available
N43	X	X	X	X	X	X	NoFix	EMON event counting of x87 loads may not work as expected
N44	X	X	X	X			Fixed	Software controlled clock modulation using a 12.5% or 25% duty cycle may cause the processor to hang
N45	X	X					Fixed	Speculative page fault may cause livelock
N46	X	X					Fixed	PAT index MSB may be calculated incorrectly

Summary of Errata

NO.	B2	C1	D0	E0	nB0	nC1	Plans	ERRATA
N47		X	X	X			Fixed	SQRTPD and SQRTSD may return QNaN indefinite instead of negative zero
N48	X	X	X	X			Fixed	Bus invalidate line requests that return unexpected data may result in L1 cache corruption
N49	X	X	X	X			Fixed	Write Combining (WC) load may result in unintended address on system bus
N50	X	X	X	X	X		Fixed	Incorrect data may be returned when page tables are in Write Combining (WC) memory space
N51		X	X	X			PlanFix	Buffer on resistance may exceed specification
N52	X	X	X	X	X	X	NoFix	Processor issues inconsistent transaction size attributes for locked operation
N53	X	X	X	X	X		Fixed	Multiple accesses to the same S-state L2 cache line and ECC error combination may result in loss of cache coherency
N54	X	X	X	X			Fixed	Processor may hang when resuming from Deep Sleep state
N55	X	X	X	X	X	X	NoFix	When the processor is in the System Management Mode (SMM), debug registers may be fully writeable
N56	X	X	X	X	X	X	NoFix	Associated counting logic must be configured when using Event Selection Control (ESCR) MSR
N57	X	X	X	X	X	X	NoFix	IA32_MC0_ADDR and IA32_MC0_MISC registers will contain invalid or stale data following a Data, Address, or Response Parity Error
N58	X	X	X	X	X		Fixed	CR2 may be incorrect or an incorrect page fault error code may be pushed onto stack after execution of an LSS instruction
N59					X		Fixed	BPM[5:3]# V _{IL} does not meet specification
N60					X	X	NoFix	Processor may hang under certain frequencies and 12.5% STPCLK# duty cycle
N61	X	X	X	X	X	X	NoFix	System may hang if a fatal cache error causes Bus Write Line (BWL) transaction to occur to the same cache line address as an outstanding Bus Read Line (BRL) or Bus Read-Invalidate Line (BRIL)
N62	X	X	X	X	X		Fixed	L2 cache may contain stale data in the Exclusive state
N63	X	X	X	X	X	X	PlanFix	Re-mapping the APIC base address to a value less than or equal to 0xDC001000 may cause IO and Special Cycle failure
N64				X	X	X	PlanFix	Erroneous BIST result found in EAX register after reset
N65	X	X	X	X	X		Fixed	Processor does not flag #GP on non-zero write to certain MSRs
N66	X	X	X	X	X	X	No Fix	Simultaneous assertion of A20M# and INIT# may result in incorrect data fetch



Summary of Errata

NO.	B2	C1	D0	E0	nB0	nC1	Plans	ERRATA
N67	X	X	X	X	X		Fixed	CPUID instruction returns incorrect number of ITLB entries
N68	X	X	X	X	X	X	No Fix	A Write to APIC Task Priority Register (TPR) That Lowers Priority Sometimes May Appear to Have not Occurred

Summary of Documentation Changes

NO.	B2	C1	D0	E0	nB0	nC1	Plans	DOCUMENTATION CHANGES
N1	X	X	X	X	X	X	Doc	SSE and SSE2 Instructions Opcodes
N2	X	X	X	X	X	X	Doc	Executing the SSE2 Variant on a Non-SSE2 Capable Processor
N3	X	X	X	X	X	X	Doc	Direction Flag (DF) Mistakenly Denoted as a System Flag
N4	X	X	X	X	X	X	Doc	Fopcode Compatibility Mode
N5	X	X	X	X	X	X	Doc	FCOS, FPTAN, FSIN, and FSINCOS Trigonometric Domain not Correct
N6	X	X	X	X	X	X	Doc	Incorrect Description of stack
N7	X	X	X	X	X	X	Doc	EFLAGS Register Correction
N8	X	X	X	X	X	X	Doc	PSE-36 Paging Mechanism
N9	X	X	X	X	X	X	Doc	0x33 Opcode
N10	X	X	X	X	X	X	Doc	Incorrect Information for SLDT
N11	X	X	X	X	X	X	Doc	LGDT/LIDT Instruction Information Correction
N12	X	X	X	X	X	X	Doc	Errors In Instruction Set Reference
N13	X	X	X	X	X	X	Doc	RSM Instruction Set Summary
N14	X	X	X	X	X	X	Doc	Correct MOVAPS and MOVAPD Operand Section
N15	X	X	X	X	X	X	Doc	DAA—Decimal Adjust AL after Addition
N16	X	X	X	X	X	X	Doc	DAS—Decimal Adjust AL after Subtraction
N17	X	X	X	X	X	X	Doc	Omission of Dependency between BTM and LBR
N18	X	X	X	X	X	X	Doc	I/O Permissions Bitmap Base Addy > 0xDFFF Does not Cause #GP(0) Fault
N19	X	X	X	X	X	X	Doc	Wrong Field Width for MINSS and MAXSS
N20	X	X	X	X	X	X	Doc	Figure 15-12 PEBS Record Format
N21	X	X	X	X	X	X	Doc	I/O Permission Bit Map
N22	X	X	X	X	X	X	Doc	Cache Description
N23	X	X	X	X	X	X	Doc	Instruction Formats and Encoding
N24	X	X	X	X	X	X	Doc	Machine-Check Initialization
N25	X	X	X	X	X	X	Doc	Incorrect Description of MOVAPS #UD
N26	X	X	X	X	X	X	Doc	PSE-36 Paging Mechanism

Summary of Documentation Changes

NO.	B2	C1	D0	E0	nB0	nC1	Plans	DOCUMENTATION CHANGES
N27	X	X	X	X	X	X	Doc	Segment Wraparound compatibility
N28	X	X	X	X	X	X	Doc	Performance Counting Clocks
N29	X	X	X	X	X	X	Doc	New Cascading Counters Chapter
N30	X	X	X	X	X	X	Doc	Updated Table B-1 in Appendix B, Vol.3
N31	X	X	X	X	X	X	Doc	Message Signaled Interrupts
N32	X	X	X	X	X	X	Doc	Selecting memory types for Pentium 4, Intel Xeon, and Pentium III processors
N33	X	X	X	X	X	X	Doc	Inaccurate Operation Description for Shift Instructions
N34	X	X	X	X	X	X	Doc	Documentation Changes to Support the Use of Hyper-Threading Technology
N35	X	X	X	X	X	X	Doc	IRET/IRETD TASK-RETURN Block has Incorrect Exception Information
N36	X	X	X	X	X	X	Doc	LGDT Exception Listing in Virtual-8086
N37	X	X	X	X	X	X	Doc	Various Table B-22 Errors and Omissions
N38	X	X	X	X	X	X	Doc	Misreporting of Exceptions for MOVDQA
N39	X	X	X	X	X	X	Doc	Effect of STI on NMI
N40	X	X	X	X	X	X	Doc	133 MHz PSB Encoding in MSR_EBC_FREQUENCY_ID Register
N41	X	X	X	X	X	X	Doc	Double Fault Exception
N42	X	X	X	X	X	X	Doc	Move To/From Control Registers

Summary of Specification Clarifications

NO.	B2	C1	D0	E0	nB0	NC1	Plans	SPECIFICATION CLARIFICATIONS
N1	X	X	X	X	X	X	Doc	Clarifying DBI# Definition for all Processors With Intel® NetBurst™ Micro-architecture

Summary of Specification Changes

NO.	B2	C1	D0	E0	nB0	NC1	Plans	SPECIFICATION CHANGES
N1	X	X	X	X	X	X	Doc	PWRGOOD specification changes
N2					X	X	Doc	PROCHOT# Pulse Width Specification is Shown TBD
N3						X	Doc	Context ID feature added to the CPUID Instruction Feature Flags/IA32_MISC_Enable Registers
N4					X	X	Doc	Multiple VID Specifications

ERRATA

N1. I/O Restart in SMM may Fail after Simultaneous Machine Check Exception (MCE)

Problem: If an I/O instruction (IN, INS, REP INS, OUT, OUTS, or REP OUTS) is being executed, and if the data for this instruction becomes corrupted, the processor will signal a Machine Check Exception (MCE). If the instruction is directed at a device that is powered down, the processor may also receive an assertion of SMI#. Since MCEs have higher priority, the processor will call the MCE handler, and the SMI# assertion will remain pending. However, upon attempting to execute the first instruction of the MCE handler, the SMI# will be recognized and the processor will attempt to execute the SMM handler. If the SMM handler is completed successfully, it will attempt to restart the I/O instruction, but will not have the correct machine state, due to the call to the MCE handler.

Implication: A simultaneous MCE and SMI# assertion may occur for one of the I/O instructions above. The SMM handler may attempt to restart such an I/O instruction, but will have an incorrect state due to the MCE handler call, leading to failure of the restart and shutdown of the processor.

Workaround: If a system implementation must support both SMM and board I/O restart, the first thing the SMM handler code should do is check for a pending MCE. If there is an MCE pending, the SMM handler should immediately exit via an RSM instruction and allow the MCE handler to execute. If there is no MCE pending, the SMM handler may proceed with its normal operation.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N2. MCA Registers may Contain Invalid Information if RESET# Occurs and PWRGOOD is not Held Asserted

Problem: This erratum can occur as a result either of the following events:

- PWRGOOD is de-asserted during a RESET# assertion causing internal glitches that may result in the possibility that the MCA registers latch invalid information.
- Or during a reset sequence if the processor's power remains valid regardless of the state of PWRGOOD, and RESET# is re-asserted before the processor has cleared the MCA registers, the processor will begin the reset process again but may not clear these registers.

Implication: When this erratum occurs, the information in the MCA registers may not be reliable.

Workaround: Ensure that PWRGOOD remains asserted throughout any RESET# assertion and that RESET# is not re-asserted while PWRGOOD is de-asserted.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N3. *Uncacheable (UC) Code in Same Line as Write Back (WB) Data may Lead to Data Corruption*

Problem: When both code (being accessed as UC or WC) and data (being accessed as WB) are aliased into the same cache line, the UC fetch will cause the processor to self-snoop and generate an implicit writeback. The data supplied by this implicit writeback may be corrupted due to the way the processor handles self-modifying code.

Implication: UC or WC code located in the same cache line as WB data may lead to data corruption.

Workaround: UC or WC code should not be located in the same physical 64 byte cache line as any location that is being stored to with WB data.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N4. *Transaction is not Retried after BINIT#*

Problem: If the first transaction of a locked sequence receives a HITM# and DEFER# during the snoop phase it should be retried and the locked sequence restarted. However, if BINIT# is also asserted during this transaction, it will not be retried.

Implication: When this erratum occurs, locked transactions will unexpectedly not be retried.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N5. *Invalid Opcode 0FFFh Requires a ModRM Byte*

Problem: Some invalid opcodes require a ModRM byte (or other following bytes), while others do not. The invalid opcode 0FFFh did not require a ModRM byte in previous generation Intel architecture processors, but does in the Intel® Pentium® 4 processor.

Implication: The use of an invalid opcode 0FFFh without the ModRM byte may result in a page or limit fault on the Intel® Pentium® 4 processor.

Workaround: Use a ModRM byte with invalid 0FFFh opcode.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N6. *RFO-ECC-Snoop-MCA Combination can Result in Two Lines being Corrupted in Main Memory*

Problem: When a snoop comes into the processor between global observation and data return for a Read-for-Ownership (RFO) request that hits an E or M state in the L2 cache that contains a correctable error, two lines in system memory may be corrupted. One of the corrupted lines is the one that contained the correctable error. The second corrupted line is unrelated to the first line.

Implication: When this erratum occurs, system and cache memory may be corrupted.

Workaround: While there is no workaround to prevent the second line from being corrupted, avoiding tight data sharing and tight spin loops will reduce the possibility of this erratum occurring. Tight spin loops can be avoided by inserting the PAUSE instruction into the loop.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N7. Overlap of MTRRs with the same Memory Type Results in a Type of Uncacheable (UC)

Problem: If two or more variable memory type range registers overlap, both with memory type X (where X is WB, WT, or WC), the resulting memory type for the overlap range will be UC instead of the more logical memory type X.

Implication: When this erratum occurs, a potentially significant performance decrease may occur for accesses to these memory ranges since the memory type has been translated to UC.

Workaround: Intel does not support the overlapping of any two or more MTRRs unless one of them is of UC memory type. Ensure that the system BIOS does not create overlapping memory ranges.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N8. FSW may not be Completely Restored after Page Fault on FRSTOR or FLDSV Instructions

Problem: If the FPU operating environment or FPU state (operating environment and register stack) being loaded by an FLDSV or FRSTOR instruction wraps around a 64Kbyte or 4Gbyte boundary and a page fault (#PF) or segment limit fault (#GP or #SS) occurs on the instruction near the wrap boundary, the upper byte of the FPU status word (FSW) might not be restored. If the fault handler does not restart program execution at the faulting instruction, stale data may exist in the FSW.

Implication: When this erratum occurs, stale data will exist in the FSW.

Workaround: Ensure that the FPU operating environment and FPU state do not cross 64Kbyte or 4Gbyte boundaries. Alternately, ensure that the page fault handler restarts program execution at the faulting instruction after correcting the paging problem.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N9. The Processor Flags #PF Instead of #AC on an Unlocked CMPXCHG8B Instruction

Problem: If a data page fault (#PF) and alignment check fault (#AC) both occur for an unlocked CMPXCHG8B instruction, then #PF will be flagged.

Implication: Software that depends #AC before #PF will be affected since #PF is flagged in this case.

Workaround: Remove the software's dependency on the fact that #AC has precedence over #PF. Alternately, reload the page in the page fault handler and then restart the faulting instruction.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

***N10. IERR# may not go Active when an Internal Error Occurs***

Problem: If the processor hangs because a store to the system bus does not complete, the processor may not assert the IERR# signal.

Implication: When this erratum occurs, IERR# is not signaled.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N11. All L2 Cache Uncorrectable Errors are Logged as Data Writes

Problem: When a Data Read operation which hits the L2 cache gets an uncorrectable error, the processor should log this error in the IA32_MC1_STATUS register as a Data Read by setting bits 7-4 to 0011b. The processor incorrectly logs Data Read operations, which hit the L2 cache and receive an uncorrectable error, with the bit pattern 0100b, indicating a Data Write Operation.

Implication: Data Read operations, which cause an uncorrectable error, are logged as Data Write operations.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N12. When in No-Fill Mode the Memory Type of Large Pages are Incorrectly Forced to Uncacheable

Problem: When the processor is operating in No-Fill Mode (CR0.CD=1), the paging hardware incorrectly forces the memory type of large (PSE-4M and PAE-2M) pages to uncacheable (UC) memory type regardless of the MTRR settings. By forcing the memory type of these pages to UC, load operations, which should hit valid data in the L1 cache, are forced to load the data from system memory. Some applications will lose the performance advantage associated with the caching permitted by other memory types.

Implication: This erratum may result in some performance degradation when using no-fill mode with large pages.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N13. Processor may Hang due to Speculative Page Walks to Non-Existent System Memory

Problem: A load operation that misses the Data Translation Lookaside Buffer (DTLB) will result in a page-walk. If the page-walk loads the Page Directory Entry (PDE) from cacheable memory and that PDE load returns data that points to a valid Page Table Entry (PTE) in uncacheable memory the processor will access the address referenced by the PTE. If the address referenced does not exist the processor will hang with no response from system memory.

Implication: Processor may hang due to speculative page walks to non-existent system memory.

Workaround: Page directories and page tables in UC memory space which are marked valid must point to physical addresses that will return a data response to the processor.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N14. Load Operations may get Stale Data in the Presence of Memory Address Aliasing

Problem: Aliasing refers to multiple logical addresses referencing the same physical address in memory. When multiple stores to the same physical memory location are pending in the processor, the processor must ensure that a subsequent instruction, which loads data from that same physical memory location, receives the data from the most recent store. When there are two pending stores in the processor to the same physical memory address, and the more recent store uses a different logical address to reference the same physical address, it is possible that a subsequent load from the same physical address may incorrectly receive the data based on the older store, rather than the most recently executed store.

Implication: When this erratum occurs, stale data will be loaded.

Workaround: It is possible for the BIOS to contain a workaround for this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N15. Writing a Performance Counter may Result in Incorrect Value

Problem: When a performance counter is written and the event counter for the event being monitored is non-zero, the performance counter will be incremented by the value on that event counter. Because the upper eight bits of the performance counter are not written at the same time as the lower 32 bits, the increment due to the non-zero event counter may cause a carry to the upper bits such that the performance counter contains a value about four billion (2^{32}) higher than what was written.

Implication: When this erratum occurs, the performance counter will contain a different value from that which was written.

Workaround: If the performance counter is set to select a null event and the counter configuration and control register (CCCR) for that counter has its compare bit set to zero, before the performance counter is written, this erratum will not occur. Since the lower 32 bits will always be correct, event counting which does not exceed 2^{32} events will not be affected.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N16. IA32_MC0_STATUS Register Overflow Bit not Set Correctly

Problem: The Overflow Error bit (bit 62) in the IA32_MC0_STATUS register indicates, when set, that a machine check error occurred while the results of a previous error were still in the error reporting bank (i.e. the valid bit was set when the new error occurred). In the case of this erratum, if an uncorrectable error is logged in the error-reporting bank and another error occurs, the overflow bit will not be set.

Implication: When this erratum occurs the overflow bit will not be set.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N17. Performance Counter may Contain Incorrect Value after being Stopped

Problem: If a performance counter is stopped on the precise internal clock cycle where the intermediate carry from the lower 32 bits of the counter to the upper eight bits occurs, the intermediate carry is lost.

Implication: When this erratum occurs, the performance counter will contain a value about 4 billion (2^{32}) less than it should.

Workaround: Since this erratum does not occur if the performance counters are read when running, a possible workaround is to read the counter before stopping it. Since the lower 32 bits will always be correct, event counting which does not exceed 2^{32} events will not be affected.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N18. The TAP Drops the Last Bit During Instruction Register Shifting

Problem: While shifting in new opcode bits during the Shift-IR state, the test access port (TAP) should shift out, via the TDO pin, a 1 followed by enough 0s to fill up the rest of the opcode length. Since the processor TAP has 7 opcode bits, it should shift out 0000001. The TAP stops driving on the same TAP clock edge that the receiver samples, with the result that 0000001 or 1000001 might be observed.

Implication: The last bit may be incorrect during instruction register shifting.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N19. Data Breakpoints on the High Half of a Floating Point Line Split may not be Captured

Problem: When a floating point load which splits a 64-byte cache line gets a floating point stack fault, and a data breakpoint register maps to the high line of the floating point load, internal boundary conditions exist that may prevent the data breakpoint from being captured.

Implication: When this erratum occurs, a data breakpoint will not be captured.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N20. MCA Error Code Field in IA32_MC0_STATUS Register may become out of Sync with the Rest of the Register

Problem: The MCA Error Code field of the IA32_MC0_STATUS register gets written by a different mechanism than the rest of the register. For uncorrectable errors, the other fields in the IA32_MC0_STATUS register are only updated by the first error. Any subsequent errors cause the Overflow Error bit to be asserted until this register is cleared. Because of this erratum, any further errors that are detected will update the MCA Error Code field without updating the rest of the register, thereby leaving the IA32_MC0_STATUS register with stale information.

Implication: When this erratum occurs, the IA32_MC0_STATUS register contains stale information.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N21. Processor may Hang on a Correctable Error and Snoop Combination

Problem: The processor will hang whenever a Read-For-Ownership (RFO) or Locked-Read-For-Ownership (LRFO) hits a line in the L2 cache and also receives a correctable error. A boundary condition in the error correction logic prevents the processor from issuing further transactions on the system bus and the processor will hang.

Implication: When this erratum occurs, the processor may hang.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.



N22. The IA32_MC1_STATUS Register may Contain Incorrect Information for Correctable Errors

Problem: When a speculative load operation hits the L2 cache and receives a correctable error, the IA32_MC1_STATUS register may be updated with incorrect information. The IA32_MC1_STATUS register should not be updated for speculative loads.

Implication: When this erratum occurs, the IA32_MC1_STATUS register will contain incorrect information for correctable errors.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N23. MCA Error Incorrectly Logged as Prefetches

Problem: An MCA error is being incorrectly logged as PREFETCH type errors in the Request sub-field of the Compound error code in the IA32_MC0_STATUS register. A store, which hits a double bit data error in the L2 cache, is incorrectly logged as a prefetch data error.

Implication: When this erratum occurs, the IA32_MC0_STATUS register will contain incorrect information.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N24. Speculative Loads which Hit the L2 cache and get an Uncorrectable Error will Log Erroneous Information

Problem: If a speculative load that hits the L2 cache and has an uncorrectable error, the load is subsequently cancelled, but the processor will still report that it has received an uncorrectable error via bit 61 of the IA32_MC1_STATUS register. Any other information in this register will not be associated with this uncorrectable error and is therefore erroneous.

Implication: When this erratum occurs, erroneous information is logged in the IA32_MC1_STATUS register.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N25. Processor may Fetch Reset Vector from Cache if A20M# is Asserted During Init

Problem: If A20M# is asserted with INIT# or after INIT# but before the first code fetch occurs, then the processor should fetch the reset vector from the system bus but instead may fetch the vector from cache.

Implication: Instead of forcing the fetch from the bus, the processor may fetch the reset vector from cache.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N26. A Correctable Error on an L2 Cache Shared State Line Hit with Go to Invalid Snoop Hangs Processor

Problem: When the following events occur:

- A read for ownership (RFO) is issued by the processor and hits a line in Shared (S) state in the L2 cache,
- The operation also receives a correctable error on the data that is read, and
- At the same time the RFO is accessing the cache, it is hit by Go to Invalid snoop,

The snoop makes the RFO appear to have missed cache. Although the RFO appears to have missed the cache, the ECC error code is not cleared and the L2 cache control logic fails to communicate that the RFO has completed. The processor does not see that the RFO has completed and will hang.

Implication: When this erratum occurs, the processor will hang. Intel has not been able to reproduce this erratum with commercial software.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N27. System Hang due to Uncorrectable Error and Bus Lock Combination

Problem: When the following events occur:

- The L2 cache receives a speculative load request from the processor just as it is starting to process a split load lock,
- The speculative load gets cancelled but only after it receives an uncorrectable error, and
- Bus Lock is asserted for the split load lock and the first half of the split load lock goes out on the system bus,

The first half of the load completes, but the uncorrectable error seen earlier prevents the dispatch of the second half of the split load lock and the processor will hang with lock asserted.

Implication: When this erratum occurs, the processor will hang.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N28. Incorrect Address for an L1 Tag Parity Error is Logged in IA32_MC1_ADDR Register

Problem: The address of an L1 tag parity error is latched one clock cycle too late resulting in the wrong address being logged in IA32_MC1_ADDR register.

Implication: When this erratum occurs, the wrong address may be logged in IA32_MC1_ADDR register in response to an L1 tag parity error.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N29. REP MOV Instruction with Overlapping Source and Destination may Result in Data Corruption

Problem: When fast strings are enabled and a REP MOV instruction is used to move a string and the source and destination strings overlap by 56 bytes or less, data corruption may occur.

Implication: When this erratum occurs, data corruption may occur.

Workaround: It is possible for the BIOS to contain a workaround for this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N30. Stale Data in Processor Translation Cache may Result in Hang

Problem: Several instructions and task switches normally invalidate the processor translation cache. Under an internal boundary condition these instructions or task switches may not completely invalidate the processor translation cache.

Implication: When this erratum occurs, subsequent processor load and store operations may use stale translations leading to unpredictable results.

Workaround: It is possible for BIOS code to contain a workaround for this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N31. I/O Buffers for FERR#, PROCHOT# and THERMTRIP# are not AGTL+

Problem: The I/O buffers for the FERR#, PROCHOT# and THERMTRIP# signals are specified in the *Intel® Pentium® 4 Processor in the 423-pin Package Datasheet* as AGTL+ buffers. The buffers for these signals were instead designed with CMOS buffers.

Implication: It is not expected that any platforms will be affected by this erratum.

Workaround: None necessary

Status: For the stepping affected see the *Summary of Changes* at the beginning of this section.

N32. RFO and Correctable Error Combination may Cause Lost Store or Hang

Problem: The processor may lose a store operation or the system may hang in the following scenario:

- Error reporting is not enabled in the IA32_MC1_CTL register, and
- The processor issues a Read for Ownership (RFO) that hits an L2 cache line in the Exclusive or Modified state.
- This RFO access receives a correctable error that occurs at the same time this cache line is hit by an external snoop.

Implication: When this erratum occurs a store operation will be lost, or the system will hang. This erratum has only been observed in a focused testing environment.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N33. RFO and Correctable Error may Incorrectly Signal the Machine Check Handler

Problem: The processor may incorrectly go to the Machine Check handler in the following scenario:

- Error reporting is enabled in the IA32_MC1_CTL register,
- The processor issues a Read for Ownership (RFO) that hits an L2 cache line in the Shared state, and
- This RFO access also receives a correctable error.
- An external snoop hits the same cacheline immediately after the RFO.

Implication: When this erratum occurs, the processor will incorrectly enter the machine check handler. A correctable error will also be reported in the IA32_MC1_STATUS and IA32_MC0_STATUS registers. This erratum has only been observed in a focused testing environment.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N34. Processor may Report Invalid TSS Fault Instead of Double Fault During Mode C Paging

Problem: When an operating system executes a task switch via a Task State Segment (TSS) the CR3 register is always updated from the new task TSS. In the mode C paging, once the CR3 is changed the processor will attempt to load the PDPTRs. If the CR3 from the target task TSS or task switch handler TSS is not valid then the new PDPTR will not be loaded. This will lead to the reporting of invalid TSS fault instead of the expected Double fault.

Implication: Operating systems that access an invalid TSS may get invalid TSS fault instead of a Double fault.

Workaround: Software needs to ensure any accessed TSS is valid.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N35. IA32_MC0_STATUS Incorrect after Illegal APIC Request

Problem: When an invalid APIC access error is logged in the IA32_MC0_STATUS register, the value returned should indicate a complex bus and interconnect error but instead indicates a complex memory hierarchy error.

Implication: When this erratum occurs, the IA32_MC0_STATUS register will contain incorrect information.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N36. Thermal Status Log Bit May not be set when the Thermal Control Circuit is Active

Problem: Bit 1 of the IA32_THERM_STATUS register (Thermal Status Log) is a sticky bit designed to be set to '1' if the thermal control circuit (TCC) has been active since either the previous processor reset or software cleared this bit. If TCC is active and the Thermal Status Log bit is cleared by a processor reset or by software, it will remain clear (set to '0') as long as the TCC remains active. Once TCC deactivates, the next activation of the TCC will set the Thermal Status Log bit.

Implication: When this erratum occurs, the Thermal Status Log bit remains cleared (set to '0') although the thermal control circuit is active.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N37. *Debug Mechanisms may not Function as Expected*

Problem: Certain debug mechanisms may not function as expected on the processor. The cases are as follows:

- When the following conditions occur: 1) An FLD instruction signals a stack overflow or underflow, 2) the FLD instruction splits a page-boundary or a 64 byte cache line boundary, 3) the instruction matches a Debug Register on the high page or cache line respectively, and 4) the FLD has a stack fault and a memory fault on a split access, the processor will only signal the stack fault and the debug exception will not be taken.
- When a data breakpoint is set on the ninth and/or tenth byte(s) of a floating point store using the Extended Real data type, and an unmasked floating point exception occurs on the store, the breakpoint will not be captured.
- When any instruction has multiple debug register matches, and any one of those debug registers is enabled in DR7, all of the matches should be reported in DR6 when the processor goes to the debug handler. This is not true during a REP instruction. As an example, during execution of a REP MOVSW instruction the first iteration a load matches DR0 and DR2 and sets DR6 as FFFF0FF5h. On a subsequent iteration of the instruction, a load matches only DR0. The DR6 register is expected to still contain FFFF0FF5h, but the processor will update DR6 to FFFF0FF1h.
- A data breakpoint that is set on a load to uncacheable memory may be ignored due to an internal segment register access conflict. In this case the system will continue to execute instructions, bypassing the intended breakpoint. Avoiding having instructions that access segment descriptor registers, e.g., LGDT, LIDT close to the UC load, and avoiding serialized instructions before the UC load will reduce the occurrence of this erratum.

Implication: Certain debug mechanisms do not function as expected on the processor.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N38. Machine Check Architecture Error Reporting and Recovery may not Work as Expected

Problem: When the processor detects errors it should attempt to report and/or recover from the error. In the situations described below, the processor does not report and/or recover from the error(s) as intended.

- When a transaction is deferred during the snoop phase and subsequently receives a Hard Failure response, the transaction should be removed from the bus queue so that the processor may proceed. Instead, the transaction is not properly removed from the bus queue, the bus queue is blocked, and the processor will hang.
- When a hardware prefetch results in an uncorrectable tag error in the L2 cache, IA32_MC0_STATUS.UNCOR and IA32_MC0_STATUS.PCC are set but no Machine Check Exception (MCE) is signaled. No data loss or corruption occurs because the data being prefetched has not been used. If the data location with the uncorrectable tag error is subsequently accessed, an MCE will occur. However, upon this MCE, or any other subsequent MCE, the information for that error will not be logged because IA32_MC0_STATUS.UNCOR has already been set and the MCA status registers will not contain information about the error which caused the MCE assertion but instead will contain information about the prefetch error event.
- When the reporting of errors is disabled for Machine Check Architecture (MCA) Bank 2 by setting all IA32_MC2_CTL register bits to 0, uncorrectable errors should be logged in the IA32_MC2_STATUS register but no machine-check exception should be generated. Uncorrectable loads on bank 2, which would normally be logged in the IA32_MC2_STATUS register, are not logged.
- When one half of a 64 byte instruction fetch from the L2 cache has an uncorrectable error and the other 32 byte half of the same fetch from the L2 cache has a correctable error, the processor will attempt to correct the correctable error but cannot proceed due to the uncorrectable error. When this occurs the processor will hang.
- When an L1 cache parity error occurs, the cache controller logic should write the physical address of the data memory location that produced that error into the IA32_MC1_ADDR register. In some instances of a parity error on a load operation that hits the L1 cache, however, the cache controller logic may write the physical address from a subsequent load or store operation into the IA32_MC1_ADDR register.
- The local xAPIC has an Error Status Register which records all errors which it detects. Bit 6 of this register, the Receive Illegal Vector bit, is set when the local xAPIC detects an illegal vector in a message that it received. When an illegal vector error is received on the same internal clock that the error status register is being written due to a previous error, bit 6 does not get set and illegal vector errors are not flagged.
- If an instruction fetch results in an uncorrectable error and there is also a debug breakpoint at this address, the processor will livelock and the uncorrectable error will not be logged in the machine check registers.
- The MCA Overflow bit should be set when an uncorrectable error resides within the register bank (valid bit is already set) and any subsequent errors occur. The Overflow bit being set indicates that more than one error has occurred. Because of this erratum, if any further errors occur, the MCA Overflow bit will not be updated; thereby incorrectly indicating only one error has been received.

Implication: The processor is unable to correctly report and/or recover from certain errors.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N39. Processor may Timeout Waiting for a Device to Respond After 0.67 Seconds

Problem: The PCI 2.1 target initial latency specification allows two seconds for a device to respond during initialization-time. The processor may timeout after only approximately 0.67 seconds. When the processor times out it will hang with IERR# asserted. PCI devices that take longer than 0.67 seconds to initialize may not be initialized properly.

Implication: System may hang with IERR# asserted.

Workaround: Due to the long initialization time observed on some commercially available PCI cards, it may be necessary to disable the timeout counter during the PCI initialization sequence. This can be accomplished by temporarily setting Bit 5 of the MISC_ENABLES_MSR located at address 1A0H to 1. This model specific register (MSR) is software visible but should only be set for the duration of the PCI initialization sequence. It is necessary to re-enable the timeout counter by clearing this bit after completing the PCI initialization sequence. CAUTION: The processor's Thermal Monitor feature may not function if the timeout counter is not re-enabled after completing the PCI initialization.

After the system is fully initialized, this erratum may occur either when a PCI device is hot added into the system or when a PCI device is transitioned from D3 cold. System software responsible for completing the hot add and the power state transition from D3 cold should allow for a delay of the target initial latency prior to initiating configuration accesses to the PCI device.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N40. Cascading of Performance Counters does not work Correctly when Forced Overflow is Enabled

Problem: The performance counters are organized into pairs. When the CASCADE bit of the Counter Configuration Control Register (CCCR) is set, a counter that overflows will continue to count in the other counter of the pair. The FORCE_OVF bit forces the counters to overflow on every non-zero increment. When the FORCE_OVF bit is set, the counter overflow bit will be set but the counter no longer cascades.

Implication: The performance counters do not cascade when the FORCE_OVF bit is set.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.



N41. Possible Machine Check Due to Line-Split Loads with Page-Tables in Uncacheable (UC) Space

Problem: The processor issues a speculative load which splits a 64-byte cache line. At the same time the page miss handling logic completes a page-walk for a different load. The resulting translation fills the DTLB and evicts the TLB entry to be used by the line-split load. Since the page tables are located in UC memory, this generates a load on the system bus for the Page Directory Entry (PDE). Due to an internal boundary condition, this load blocks any subsequent loads from the completing.

Implication: The timeout counter activates leading to a machine check.

Workaround: Avoid placing the page directory and the page table in uncacheable memory space.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N42. IA32_MC1_STATUS MSR ADDRESS VALID bit may be set when no Valid Address is Available

Problem: The processor should only log the address for L1 parity errors in the IA32_MC1_STATUS MSR if a valid address is available. If a valid address is not available, the ADDRESS VALID bit in the IA32_MC1_STATUS MSR should not be set. In instances where an L1 parity error occurs and the address is not available because the linear to physical address translation is not complete or an internal resource conflict has occurred, the ADDRESS VALID bit is incorrectly set.

Implication: The ADDRESS VALID bit is set even though the address is not valid.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N43. EMON Event Counting of x87 Loads may not Work as Expected

Problem: If a performance counter is set to count x87 loads and floating point exceptions are unmasked, the FPU Operand Data Pointer (FDP) may become corrupted.

Implication: When this erratum occurs, the FPU Operand Data Pointer (FDP) may become corrupted.

Workaround: This erratum will not occur with floating point exceptions masked. If floating point exceptions are unmasked, then performance counting of x87 loads should be disabled.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N44. Software Controlled Clock Modulation using a 12.5% or 25% Duty Cycle may cause the Processor to Hang

Problem: Processor clock modulation may be controlled via a processor register (IA32_THERM_CONTROL). The On-Demand Clock Modulation Duty Cycle is controlled by bits 3:1. If these bits are set to a duty cycle of 12.5% or 25%, the processor may hang while attempting to execute a floating-point instruction. In this failure, the last instruction pointer (LIP) is pointing to a floating-point instruction whose instruction bytes are in UC space and which takes an exception 16 (floating point error exception). The processor stalls trying to fetch the bytes of the faulting floating-point instruction and those following it. This processor hang is caused by interactions between thermal control circuit and floating-point event handler.

Implication: The processor will go into a sleep state from which it fails to return.

Workaround: Use a duty cycle other than 12.5% or 25%.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N45. Speculative Page Fault may cause Livelock

Problem: If the processor detects a page fault which is corrected before the operating system page fault handler can be called e.g. DMA activity modifies the page tables and the corrected page tables are left in a non-accessed or not dirty state, the processor may livelock. Intel has not been able to reproduce this erratum with commercial software.

Implication: Should this erratum be encountered the processor will livelock resulting in a system hang or operating system failure.

Workaround: It is possible for the BIOS to contain a workaround for this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N46. PAT Index MSB may be Calculated Incorrectly

Problem: When Mode B or Mode C paging support is enabled and all of the following events occur:

- A page walk occurs that returns a large page from memory, and
- A second page walk occurs that hits an internal processor cache for a 4k page and the Page Attribute Table (PAT) upper index bit in the Page Table Entry for this page is set to 1b.

It is possible that the PAT upper index bit in the PTE for this 4k page is incorrectly ignored and assumed to be 0b. The result is that the memory type in the PAT that should have come from the corresponding PAT index [4-7] incorrectly comes from PAT index [0-3].

Implication: If an operating system has programmed the PAT in an asymmetrical fashion i.e. PAT[0-3] is different from PAT[4-7] then an incorrect memory type may be used.

Workaround: None identified

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.



N47. SQRTPD and SQRTSD may Return QNaN Indefinite Instead of Negative Zero

Problem: When DAZ mode is enabled, and a SQRTPD or SQRTSD instruction has a negative denormal operand, the instruction will return a QNaN indefinite when the specified response should be a negative zero.

Implication: When this erratum occurs, the instruction will return a QNaN indefinite when a negative zero is expected.

Workaround: Ensure that negative denormals are not used as operands to the SQRTPD or SQRTSD instructions when DAZ mode is enabled. Software could enable FTZ mode to ensure that negative denormals are not generated by computation prior to execution of a SQRTPD or SQRTSD instruction.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N48. Bus Invalidate Line Requests that Return Unexpected Data may Result in L1 Cache Corruption

Problem: When a Bus Invalidate Line (BIL) request receives unexpected data from a deferred reply, and a store operation write combines to the same address, there is a small window where the L0 is corrupt, and loads can retire with this corrupted data. This erratum occurs in the following scenario:

- A Read-For-Ownership (RFO) transaction is issued by the processor and hits a line in shared state in the L1 cache.
- The RFO is then issued on the system bus as a 0 length Read-Invalidate (a BIL), since it doesn't need data, just ownership of the cache line.
- This transaction is deferred by the chipset.
- At some later point, the chipset sends a deferred reply for this transaction with an implicit write-back response. For this erratum to occur, no snoop of this cache line can be issued between the BIL and the deferred reply.
- The processor issues a write-combining store to the same cache line while data is returning to the processor. This store straddles an 8-byte boundary.
- Due to an internal boundary condition, a time window exists where the L1 cache contains corrupt data which could be accessed by a load.

Implication: No known commercially available chipsets trigger the failure conditions.

Workaround: The chipset could issue a BIL (snoop) to the deferred processor to eliminate the failure conditions.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N49. Write Combining (WC) Load May Result in Unintended Address on System Bus

Problem: When the processor performs a speculative write combining (WC) load, down the path of a mispredicted branch, and the address happens to match a valid UnCacheable (UC) address translation with

the Data Translation Look-Aside Buffer, an unintended UnCacheable load operation may be sent out on the system bus.

Implication: When this erratum occurs, an unintended load may be sent on system bus. Intel has only encountered this erratum during pre-silicon simulation.

Workaround: It is possible for the BIOS to contain a workaround for this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N50. Incorrect Data May be Returned When Page Tables Are In Write Combining (WC) Memory Space

Problem: If page directories and/or page tables are located in Write Combining (WC) memory, speculative loads to cacheable memory may complete with incorrect data.

Implication: Cacheable loads to memory mapped using page tables located in write combining memory may return incorrect data. Intel has not been able to reproduce this erratum with commercially available software.

Workaround: Do not place page directories and/or page tables in WC memory.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N51. Buffer On Resistance May Exceed Specification

Problem: The datasheet specifies the resistance range for R_{ON} (Buffer On Resistance) for the AGTL+ and Asynchronous GTL+ buffers as 5 to 11 ohms. Due to this erratum, R_{ON} may be as high as 13.11 ohms.

Implication: The R_{ON} value affects the voltage level of the signals when the buffer is driving the signal low. A higher R_{ON} may adversely affect the system's ability to meet specifications such as V_{IL} . As the system design also affects margin to specification, designs may or may not have sufficient margin to function properly with an increased R_{ON} . System designers should evaluate whether a particular system is affected by this erratum. Designs that follow the recommendations in the *Intel® Pentium® 4 Processor and Intel® 850 Chipset Platform Design Guide* are not expected to be affected.

Workaround: No workaround is necessary for systems with margin sufficient to accept a higher R_{ON} .

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N52. Processor Issues Inconsistent Transaction Size Attributes for Locked Operation

Problem: When the processor is in the Page Address Extension (PAE) mode and detects the need to set the Access and/or Dirty bits in the page directory or page table entries, the processor sends an 8 byte load lock onto the system bus. A subsequent 8 byte store unlock is expected, but instead a 4 byte store unlock occurs. Correct data is provided since only the lower bytes change, however external logic monitoring the data transfer may be expecting an 8 byte store unlock.

Implication: No known commercially available chipsets are affected by this erratum.

Workaround: None identified.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N53. Multiple Accesses to the Same S-State L2 Cache Line and ECC Error Combination May Result in Loss of Cache Coherency

Problem: When a Read for Ownership (RFO) cycle has a 64 bit address match with an outstanding read hit on a line in the L2 cache which is in the S-state AND that line contains an ECC error, the processor should recycle the RFO until the ECC error is handled. Due to this erratum, the processor does not recycle the RFO and attempts to service both the RFO and the read hit at the same time.

Implication: When this erratum occurs, cache may become incoherent.

Workaround: None identified.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N54. Processor May Hang When Resuming From Deep Sleep State

Problem: When resuming from the Deep Sleep state the address strobe signals (ADSTB[1:0]#) may become out of phase with respect to the system bus clock (BCLK).

Implication: When this erratum occurs, the processor will hang.

Workaround: The system BIOS should prevent the processor from going to the Deep Sleep state.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N55. When the Processor is in the System Management Mode (SMM), Debug Registers May be Fully Writeable

Problem: When in System Management Mode (SMM), the processor executes code and stores data in the SMRAM space. When the processor is in this mode and writes are made to DR6 and DR7, the processor should block writes to the reserved bit locations. Due to this erratum, the processor may not block these writes. This may result in invalid data in the reserved bit locations.

Implication: Reserved bit locations within DR6 and DR7 may become invalid.

Workaround: Software may perform a read/modify/write when writing to DR6 and DR7 to ensure that the values in the reserved bits are maintained.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N56. Associated Counting Logic Must be Configured When Using Event Selection Control (ESCR) MSR

Problem: ESCR MSRs allow software to select specific events to be counted, with each ESCR usually associated with a pair of performance counters. ESCRs may also be used to qualify the detection of at-retirement events that support precise-event-based sampling (PEBS). A number of performance metrics that support PEBS require a 2nd ESCR to tag uops for the qualification of at-retirement events. (The first ESCR is required to program the at-retirement event.) Counting is enabled via counter configuration control registers (CCCR) while the event count is read from one of the associated counters. When counting logic is configured for the subset of at-retirement events that require a 2nd ESCR to tag uops, at least one of the CCCRs in the same group of the 2nd ESCR must be enabled.

Implication: If no CCCR/counter is enabled in a given group, the ESCR in that group that is programmed for tagging uops will have no effect. Hence a subset of performance metrics that require a 2nd ESCR for tagging uops may result in 0 count.

Workaround: Ensure that at least one CCCR/counter in the same group as the tagging ESCR is enabled for those performance metrics that require two ESCRs and tagging uops for at-retirement counting.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N57. IA32_MC0_ADDR and IA32_MC0_MISC Registers Will Contain Invalid or Stale Data Following a Data, Address, or Response Parity Error

Problem: If the processor experiences a data, address, or response parity error, the ADDR_V and MISC_V bits of the IA32_MC0_STATUS register are set, but the IA32_MC0_ADDR and IA32_MC0_MISC registers are not loaded with data regarding the error.

Implication: When this erratum occurs, the IA32_MC0_ADDR and IA32_MC0_MISC registers will contain invalid or stale data.

Workaround: Ignore any information in the IA32_MC0_ADDR and IA32_MC0_MISC registers after a data, address or response parity error.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N58. CR2 May Be Incorrect or an Incorrect Page Fault Error Code May Be Pushed onto Stack After Execution of an LSS Instruction

Problem: Under certain timing conditions, the internal load of the selector portion of the LSS instruction may complete with potentially incorrect speculative data before the load of the offset portion of the address completes. The incorrect data is corrected before the completion of the LSS instruction but the value of CR2 and the error code pushed on the stack are reflective of the speculative state. Intel has not observed this erratum with commercially available software.

Implication: When this erratum occurs, the contents of CR2 may be off by two, or an incorrect page fault error code may be pushed onto the stack.

Workaround: It is possible for the BIOS to contain a workaround for this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N59. BPM[5:3]# V_{IL} Does Not Meet Specification

Problem: The V_{IL} for BPM[5:3]# is specified as $0.9 * GTLREF$ [V]. Due to this erratum the V_{IL} for these signals is $0.9 * GTLREF - .100$ [V].

Implication: The processor requires a lower input voltage than specified to recognize a low voltage on the BPM[5:3]# signals.

Workaround: When intending to drive the BPM[5:3]# signals a low, ensure that the system provides a voltage lower than $0.9 * GTLREF - .100$ [V].

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N60. Processor May Hang Under Certain Frequencies and 12.5% STPCLK# Duty Cycle

Problem: If a system de-asserts STPCLK# at a 12.5% duty cycle, the processor is running below 2 GHz, and the processor thermal control circuit (TCC) on-demand clock modulation is active, the processor may hang. This erratum does not occur under the automatic mode of the TCC.

Implication: When this erratum occurs, the processor will hang.

Workaround: If use of the on-demand mode of the processor's TCC is desired in conjunction with STPCLK# modulation, then assure that STPCLK# is not asserted at a 12.5% duty cycle.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N61. System May Hang if a Fatal Cache Error Causes Bus Write Line (BWL) Transaction to Occur to the Same Cache Line Address as an Outstanding Bus Read Line (BRL) or Bus Read-Invalidate Line (BRIL)

Problem: A processor internal cache fatal data ECC error may cause the processor to issue a BWL transaction to the same cache line address as an outstanding BRL or BRIL. As it is not typical behavior for a single processor to have a BWL and a BRL/BRIL concurrently outstanding to the same address, this may represent an unexpected scenario to system logic within the chipset.

Implication: The processor may not be able to fully execute the machine check handler in response to the fatal cache error if system logic does not ensure forward progress on the system bus under this scenario.

Workaround: System logic should ensure completion of the outstanding transactions. Note that during recovery from a fatal data ECC error, memory image coherency of the BWL with respect to BRL/BRIL transactions is not important. Forward progress is the primary requirement.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N62. L2 Cache May Contain Stale Data in the Exclusive State

Problem: If a cacheline (A) is in Modified (M) state in the write-combining (WC) buffers and in the Invalid (I) state in the L2 cache and its adjacent sector (B) is in the Invalid (I) state and the following scenario occurs:

1. A read to B misses in the L2 cache and allocates cacheline B and its associated second-sector pre-fetch into an almost full bus queue,
2. A Bus Read Line (BRL) to cacheline B completes with HIT# and fills data in Shared (S) state,
3. The bus queue full condition causes the prefetch to cacheline A to be cancelled, cacheline A will remain M in the WC buffers and I in the L2 while cacheline B will be in the S state.

Then, if the further conditions occur:

1. Cacheline A is evicted from the WC Buffers to the bus queue which is still almost full,
2. A hardware prefetch Read for Ownership (RFO) to cacheline B, hits the S state in the L2 and observes cacheline A in the I state, allocates both cachelines,
3. An RFO to cacheline A completes before the WC Buffers write modified data back, filling the L2 with stale data,
4. The writeback from the WC Buffers completes leaving stale data, for cacheline A, in the Exclusive (E) state in the L2 cache.

Implication: Stale data may be consumed leading to unpredictable program execution. Intel has not been able to reproduce this erratum with commercial software.

Workaround: It is possible for BIOS to contain a workaround for this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.



N63. *Re-Mapping The APIC Base Address to a Value Less than or Equal to 0xDC001000 May Cause IO and Special Cycle Failure*

Problem: Remapping the APIC base address from its default can cause conflicts with either I/O or special cycle bus transactions.

Implication: Either I/O or special cycle bus transactions can be redirected to the APIC, instead of appearing on the front-side bus.

Workaround: Use any APIC base addresses above 0xDC001000 as the relocation address.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N64. *Erroneous BIST Result Found in EAX Register After Reset*

Problem: The processor may show an erroneous BIST (built-in self test) result in the EAX register bit 0 after coming out of reset.

Implication: When this erratum occurs, an erroneous BIST failure will be reported in the EAX register bit 0, however this failure can be ignored since it is not accurate.

Workaround: It is possible for BIOS to workaround this issue by masking off bit 0 in the EAX register where BIST results are written.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N65. *Processor Does not Flag #GP on Non-zero Write to Certain MSRs*

Problem: When a non-zero write occurs to the upper 32 bits of IA32_CR_SYSENTER_EIP or IA32_CR_SYSENTER_ESP, the processor should indicate a general protection fault by flagging #GP. Due to this erratum, the processor does not flag #GP.

Implication: The processor unexpectedly does not flag #GP on a non-zero write to the upper 32 bits of IA32_CR_SYSENTER_EIP or IA32_CR_SYSENTER_ESP. No known commercially available operating system has been identified to be affected by this erratum.

Workaround: None identified.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N66. *Simultaneous Assertion of A20M# and INIT# may Result in Incorrect Data Fetch*

Problem: If A20M# and INIT# are simultaneously asserted by software, followed by a data access to the 0xFFFFFXXX memory region, with A20M# still asserted, incorrect data will be accessed. With A20M# asserted, an access to 0xFFFFFXXX should result in a load from physical address 0xFFEFFXXX. However, in the case of A20M# and INIT# being asserted together, the data load will actually be from the physical address 0xFFFFFXXX. Code accesses are not effected by this erratum.

Implication: Processor may fetch incorrect data, resulting in BIOS failure.

Workaround: Deasserting and reasserting A20M# prior to the data access will workaround this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N67. *CPUID Instruction Returns Incorrect Number of ITLB Entries*

Problem: When CPUID instruction is executed with EAX = 2 on a processor without Hyper-Threading Technology or with Hyper-Threading Technology disabled via power on configuration, it should return a value of 51h in EAX[15:8] to indicate that the Instruction Translation Lookaside Buffer (ITLB) has 128 entries. On a processor with Hyper-Threading Technology enabled, the processor should return 50h (64 entries). Due to this erratum, the CPUID instruction always returns 50h (64 entries).

Implication: Software may incorrectly report the number of ITLB entries. Operation of the processor is not affected.

Workaround: None identified.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

N68. *A Write to APIC Task Priority Register (TPR) That Lowers Priority Sometimes May Appear to Have not Occurred*

Problem: Un-cacheable stores to the APIC space are handled in a non-synchronized way in respect to the speed at which instructions are retired. If an instruction that masks the interrupt flag, e.g. CLI, is executed soon after an un-cacheable write to the TPR that lowers the APIC priority the interrupt masking operation may take effect before the actual priority has been lowered. This may cause interrupts whose priority is lower than the initial TPR but higher than the final TPR to not be serviced until the interrupt flag is finally cleared, e.g. by STI. Interrupts will remain pending and are not lost.

Implication: This condition may allow interrupts to be accepted by the processor but may delay their service.

Workaround: This can be avoided by issuing a TPR Read after a TPR Write that lowers the TPR value. This will force the store to the APIC priority resolution logic before any subsequent instructions are executed. No commercial operating system is known to be impacted by this erratum.

Status: For the steppings affected see the *Summary of Changes* at the beginning of this section.

DOCUMENTATION CHANGES

The Documentation Changes listed in this section apply to the following documents:

- *Intel Architecture Software Developer's Manual, Volumes 1, 2, and 3*
- *Intel® Pentium® 4 Processor in the 423-pin Package* datasheet
- *Intel® Pentium® 4 Processor in the 478-pin Package* datasheet
- *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet

All Documentation Changes will be incorporated into a future version of the appropriate Intel Pentium 4 processor documentation.

Note: Documentation changes for IA-32 Intel(R) Architecture Software Developer's Manual volumes 1, 2, and 3 will be posted in a separate document " IA-32 Intel(R) Architecture Software Developer's Manual Documentation Changes". Please follow the link below to become familiar with this file.

<http://developer.intel.com/design/pentium4/specupdt/252046.htm>

N1. SSE and SSE2 Instructions Opcodes

The note at the end of section 2.2 in the *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* states:

NOTE:

Some of the SSE and SSE2 instructions have three-byte opcodes. For these three-byte opcodes, the third opcode byte may be F2H, F3H, or 66H. For example, the SSE2 instruction CVTDQ2PD has the three-byte opcode F3 OF E6. The third opcode byte of these three-byte opcodes should not be thought of as a prefix, even though it has the same encoding as the operand size prefix (66H) or one of the repeat prefixes (F2H and F3H). As described above, using the operand size and repeat prefixes with SSE and SSE2 instructions is reserved.

It should state:

NOTE:

Some of the SSE and SSE2 instructions have three-byte opcodes. For these three-byte opcodes, the third opcode byte may be F2H, F3H, or 66H. For example, the SSE2 instruction CVTDQ2PD has the three-byte opcode F3 OF E6. The third opcode byte of these three-byte opcodes should not be thought of as a prefix, even though it has the same encoding as the operand size prefix (66H) or one of the repeat prefixes (F2H and F3H). As described above, using the operand size and repeat prefixes with SSE and SSE2 instructions is reserved. It should also be noted that execution of SSE2 instructions on an Intel processor that does not support SSE2 (CPUID Feature flag register EDX bit 26 is clear) will result in unpredictable code execution.

N2. **Executing the SSE2 Variant on a Non-SSE2 Capable Processor**

In *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* the section for each of the following instructions states that executing the instruction in real or protected mode on a processor for which the SSE2 feature flag returned by CPUID is 0 (SSE2 not supported by the processor) will result in the generation of an undefined opcode exception (#UD). This is incorrect. The SSE2 form of these instructions is defined by opcodes for which the leading opcode byte maps into an operand size prefix. Executing the SSE2 variant of these instructions on a non-SSE2 capable processor will result in an SSE like operation and not a #UD. Refer to section 2.2 of the *Intel Architecture Software Developer's Manual, Vol 2* for more detail.

Instructions:

MOVD xmm, r32; MOVD r32, xmm; MOVDQA; MOVDQU; MOVQ xmm, m64; PACKSSWB/DW; PACKUSWB; PADDB/W/D; PADDDB/W; PADDUSB/W; PAND; PANDN; PCMPEQB/W/D; PCMPGTB/W/D; PMADDWD; PMULHW; PMULLW; POR; PSLLW/D/Q; PSRAW/D; PSRLW/D/Q; PSUBB/W/D; PSUBSB/W; PSUBUSB/W; PUNPCKHBW/WD/DQ; PUNPCKLBW/WD/DQ; PXOR.

N3. **Direction Flag (DF) Mistakenly Denoted as a System Flag**

The *Intel Architecture Software Developer's Manual, Vol 1: Basic Architecture* Section 3.4.3 "EFLAGS Register", in Figure 3-7, EFLAGS Register currently states:

X Direction Flag(DF)

It should state:

C Direction Flag(DF)

N4. **Fopcode Compatibility Mode**

The *Intel Architecture Software Developer's Manual, Vol 1: Basic Architecture* Section 8.1.8.1 "FOPCODE COMPATIBILITY MODE" currently states:

"When the FOP code compatibility mode is enabled, the IA32 architecture guarantees that if an unmasked x87 FPU floating-point exception is generated, the opcode of the last non-control instruction executed prior to the generation of the exception will be stored in the x87 FPU opcode register, and that value can be read by a subsequent FSAVE or FXSAVE instruction. When the fop compatibility mode is disabled (default), the value stored in the x87 FPU opcode register is undefined (reserved)."

It should state:

"If FOP code compatibility mode is enabled, the FOP is defined as it has always been in previous IA32 implementations (always defined as the FOP of the last non-transparent FP instruction executed before a FSAVE/STENV/FXSAVE).

If FOP code compatibility mode is disabled (default), FOP is only valid if the last non-transparent FP instruction executed before a FSAVE/FSTENV/FXSAVE had an unmasked exception."

N5. **FCOS, FPTAN, FSIN, and FSINCOS Trigonometric Domain not Correct**

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Section 3.2 "INSTRUCTION REFERENCE" FCOS, FPTAN, FSIN, and FSINCOS trigonometric domain for C2 is incorrect. Under the FPU Flags affected, C2 currently states:

C2 Set to 1 if source operand is outside the range -2^{63} to $+2^{63}$; otherwise, cleared to 0.

It should state:

C2 Set to 1 if outside range $-2^{63} < \text{source operand} < +2^{63}$; otherwise, set to 0.

N6. **Incorrect Description of Stack**

The *Intel Architecture Software Developer's Manual, Volume 1: Basic Architecture* Chapter 6, Section 6.2 paragraph 2, labeled "STACK" currently states:

The next available memory location on the stack is called the top of stack. At any given time, the stack pointer (contained in the ESP register) gives the address (that is the offset from the base of the SS segment) of the top of the stack.

This paragraph is incorrect and will be removed from the section listed above.

N7. **EFLAGS Register Correction**

The *Intel Architecture Software Developer's Manual, Volume 1: Basic Architecture* Section 3.7.2, Figure 3.7 "EFLAGS Register," currently states:

Bit 11 "OF" as "X"

It should state:

Bit 11 "OF" as "S"

N8. **PSE-36 Paging Mechanism**

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Chapter 3, Section 3.9, third paragraph currently states:

As is shown in Table 3-3, the following flags must be set or cleared to enable the PSE-36 paging mechanism:

- PSE-36 CPUID feature flag-When set, it indicates the availability of the PSE-36 paging mechanism on the IA-32 processor on which the CPUID instruction is executed.
- PG flag (bit 31) in register CR0-Set to 1 to enable paging.
- PSE flag (bit 4) in control register CR4 - Set to 1 to enable the page size extension for 4-Mbyte pages.
- PAE flag (bit 5) in control register CR4-Clear to 0 to disable the PAE paging mechanism.

It should state:

As is shown in Table 3-3, the following flags must be set or cleared to enable the PSE-36 paging mechanism:

- PSE-36 CPUID feature flag-When set, it indicates the availability of the PSE-36 paging mechanism on the IA-32 processor on which the CPUID instruction is executed.
- PG flag (bit 31) in register CR0-Set to 1 to enable paging.
- PAE flag (bit 5) in control register CR4-Clear to 0 to disable the PAE paging mechanism.
- PSE flag (bit 4) in control register CR4 and the PS flag in PDE- Set to 1 to enable the page size extension for 4-Mbyte pages.
- Or the PSE flag (bit 4) in control register CR4- Set to 1 and the PS flag (bit 7) in PDE- Set to 0 to enable 4-KByte pages with 32-bit addressing (below 4GBytes).

N9. 0x33 Opcode

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Appendix A, Table A-2, the opcode corresponding to 0x33 currently states:

Gb, Ev

It should state:

Gv, Ev

Also, Page 3-791, XOR-Logical Exclusive OR, the two entries for opcode 33 currently states:

Opcode	Instruction	Description
33 /r	XOR r16,r/m16	r8 XOR r/m8
33 /r	XOR r32,r/m32	r8 XOR r/m8

It should state:

Opcode	Instruction	Description
33 /r	r16 XOR r/m16	r8 XOR r/m8
33 /r	r32 XOR r/m32	r8 XOR r/m8

N10. Incorrect Information for SLDT

In the *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference*, the opcode/Instruction/Description table for SLDT currently states "SLDT *r/m32* Store segment selector from LDTR in low-order 16 bits of *r/m32*" but should instead state "SLDT *r32* Store segment selector from LDTR in low-order 16 bits of *r32*."

N11. LGDT/LIDT Instruction Information Correction

In the *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference*, the sentence in the LGDT/LIDT instruction section that currently states:

"See 'SFENCE -- Store Fence' in this chapter for information on storing the contents of the GDTR and IDTR."

It should state:

"See 'SGDT/SIDT' in this chapter for information on storing the contents of the GDTR and IDTR."

N12. Errors in Instruction Set Reference

The following changes will be made to the *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference*:

1. Page 3-586 "PMULUDQ—Multiply Packed Unsigned Doubleword Integers" currently states:

66 OF F4 /r PMULUDQ xmm1, xmm2/m128

It should state:

66 0F F4 /r PMULUDQ xmm1, xmm2/m128

2. Page A-9, Table A-3, Two-byte Opcode Map:08H-7FH (First Byte is 0FH), entry 2B currently states:

MOVNTPS
Wps, Vps
MOVNTPS (66)
Wpd, Vpd

It should state:

MOVNTPS
Wps, Vps
MOVNTPD (66)
Wpd, Vpd

3. Page A-9, Table A-3, Two-byte Opcode Map:08H-7FH (First Byte is 0FH).

Entry 3C currently states:

Blank (empty space)

It should state:

MOVNTI

4. *Page A-10, Table A-3, Two-byte Opcode Map:80H-7FH (First Byte is 0FH).*

Entry D7 currently states:

PMOVMKSB
Gd, Pq
PMOVMKSB (66)
Gd, Vdq

It should state:

PMOVMKSB
Gd, Pq
PMOVMKSB (66)
Gd, Vdq

5. *Page A-10, Table A-3, Two-byte Opcode Map:80H-7FH (First Byte is 0FH).*

Entry F7 currently states:

MASKMOVQ
Ppi, Qpi
MASKMOVQU (66)
Vdq, Wdq

It should state:

MASKMOVQ
Ppi, Qpi
MASKMOVDQU (66)
Vdq, Wdq

6. *Page A-11, Table A-3, Two-byte Opcode Map:88H-7FH (First Byte is 0FH).*

The title table currently states:

Table A-3. Two-byte Opcode Map:88H-7FH (First Byte is FFH)

It should state:

Table A-3. Two-byte Opcode Map:88H-7FH (First Byte is 0FH)

7. *Page A-11, Table A-3, Two-byte Opcode Map:88H-7FH (First Byte is 0FH).*

Entry FB currently states:

PSUBD
Pq, Qq
PSUBD (66)
Vdq, Wdq

It should state:

PSUBQ
Pq, Qq
PSUBQ (66)
Vdq, Wdq

8. *Page B-21, Table B-12, MMX Instruction Formats and Encodings (Contd.).*

Entry PMADD currently states:

PMADD – Packed Multiply add

It should state:

PMADDWD – Packed Multiply add

9. *Page B-21, Table B-12, MMX Instruction Formats and Encodings (Contd.).*

Entry PMULH currently states:

PMULH – Packed multiplication

It should state:

PMULHW – Packed multiplication, store high word

10. *Page B-21, Table B-12, MMX Instruction Formats and Encodings (Contd.).*

Add instruction PMULHUW :

PMULHUW – Packed multiplication, store high word (unsigned)

mmxreg2 to mmxreg1	0000 1111: 1110 0100: 11 mmxreg1 mmxreg2
memory to mmxreg	0000 1111: 1110 0100: mod mmxreg r/m

11. *Page B-21, Table B-12, MMX Instruction Formats and Encodings (Contd.).*

Entry PMULL currently states:

PMULL – Packed multiplication

It should state:

PMULLW – Packed multiplication, store low word

12. *Page B-40, Table B-19, Formats and Encodings of the SSE2 SIMD Integer Instruction.*

Entry PMADD currently states:

PMADD – Packed multiply add

It should state:

PMADDWD – Packed multiply add

13. *Page B-41, Table B-19, Formats and Encodings of the SSE2 SIMD Integer Instruction.*
Entry PMULH currently states:

PMULH – Packed multiplication

It should state:

PMULHW – Packed multiplication, store high word

14. *Page B-41, Table B-19, Formats and Encodings of the SSE2 SIMD Integer Instruction.*
Add instruction PMULHUW:

PMULHUW – Packed multiplication, store high word (unsigned)

xmmreg2 to xmmreg1	0110 0110 : 0000 1111 : 11110 0100 : 11	xmmreg1 xmmreg2
memory to xmmreg	0110 0110 : 0000 1111 : 1110 0100 : mod	xmmreg r/m

15. *Page B-41, Table B-19, Formats and Encodings of the SSE2 SIMD Integer Instruction.*
Entry PMULL currently states:

PMULL – Packed multiplication

It should state:

PMULLW – Packed multiplication, store low word

N13. RSM Instruction Set Summary

The *Intel Architecture Software Developer's Manual, Vol 1: Basic Architecture* Section 5.8 "INSTRUCTION SET SUMMARY" currently states:

RSM Return from system management mode (SSM)

It should state:

RSM Return from system management mode (SMM)

N14. Correct MOVAPS and MOVAPD Operand Section

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Section 3.2 "INSTRUCTION REFERENCE" MOVAPS and MOVAPD operation section currently states:

Operation

DEST ← SRC;

It should state:

Operation

DEST ← SRC;

* #GP if SRC or DEST unaligned memory operand *;

N15. DAA—Decimal Adjust AL after Addition

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* page 3-173 currently states:

Operation

```
IF (((AL AND 0FH) > 9) or AF = 1)
  THEN
    AL ← AL + 6;
    CF ← CF OR CarryFromLastAddition; (* CF OR carry from AL ← AL + 6 *)
    AF ← 1;
  ELSE
    AF ← 0;
FI;
IF ((AL AND F0H) > 90H) or CF = 1)
  THEN
    AL ← AL + 60H;
    CF ← 1;
  ELSE
    CF ← 0;
FI;
```

It should state:

Operation

```
old_AL ← AL;
old_CF ← CF;
CF ← 0;
IF (((AL AND 0FH) > 9) or AF = 1)
  THEN
    AL ← AL + 6;
    CF ← old_CF or (Carry from AL ← AL + 6);
    AF ← 1;
  ELSE
    AF ← 0;
FI;
IF ((old_AL > 99H) or (old_CF = 1)
  THEN
    AL ← AL + 60H;
    CF ← 1;
  ELSE
    CF ← 0;
FI;
```

N16. *DAS—Decimal Adjust AL after Subtraction*

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* page 3-175 currently states:

Operation

```
IF (AL AND 0FH) > 9 OR AF = 1
THEN
    AL ← AL - 6;
    CF ← CF OR CarryFromLastAddition; (* CF OR carry from AL ← AL - 6 *)
    AF ← 1;
ELSE AF ← 0;
FI;
IF ((AL > 9FH) or CF = 1)
THEN
    AL ← AL - 60H;
    CF ← 1;
ELSE CF ← 0;
FI;
```

It should state:

Operation

```
old_AL ← AL;
old_CF ← CF;
CF ← 0;
IF (((AL AND 0FH) > 9) or AF = 1)
THEN
    AL ← AL - 6;
    CF ← old_CF or (Borrow from AL ← AL - 6);
    AF ← 1;
ELSE
    AF ← 0;
FI;
IF ((old_AL > 99H) OR (old_CF = 1))
THEN
    AL ← AL - 60H;
    CF ← 1;
ELSE
    CF ← 0;
FI;
```

N17. *Omission of Dependency Between BTM and LBR*

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Chapter 15, Section 5.3, on page 15-15 currently states:

15.5.3. Monitoring Branches, Exceptions, and Interrupts (Pentium 4 and Intel Xeon Processors)

When the LBR flag in the IA32_DEBUGCTL MSR is set, the processor automatically begins

recording branch records for taken branches, interrupts, and exceptions (except for debug exceptions) in the LBR stack MSRs.

When the processor generates a debug exception (#DB), it automatically clears the LBR flag before executing the exception handler, but does not touch the LBR stack MSRs. The branch records for the last four taken branches, interrupts, and/or exceptions are thus retained for analysis by the debugger program.

The debugger can use the linear addresses in the LBR stack to reset breakpoints in the break-point-address registers (DR0 through DR3), allowing a backward trace from the manifestation of a particular bug toward its source.

Before resuming program execution from a debug-exception handler, the handler must set the LBR flag again to re-enable last branch recording.

It should state:

15.5.3. Monitoring Branches, Exceptions, and Interrupts (Pentium 4 and Intel Xeon Processors)

When the LBR flag in the IA32_DEBUGCTL MSR is set, the processor automatically begins recording branch records for taken branches, interrupts, and exceptions (except for debug exceptions) in the LBR stack MSRs.

When the processor generates a debug exception (#DB), it automatically clears the LBR flag before executing the exception handler. This action does not clear previously stored LBR stack MSRs. The branch record for the last four taken branches, interrupts and/or exceptions are retained for analysis.

A debugger can use the linear addresses in the LBR stack to reset breakpoints in the break-point address registers (DR0 through DR3). This allows a backward trace from the manifestation of a particular bug toward its source.

If the LBR flag is cleared and TR flag in the IA32_DEBUGCTLTR MSR remains set, the processor will continue to update LBR stack MSRs. This is because BTM information must be generated from entries in the LBR stack (see 14.5.5). A #DB does not automatically clear the TR flag.

N18. I/O Permissions Bitmap Base Addy > 0xDFFF Does not Cause #GP(0) Fault

The *Intel Architecture Software Developer's Manual, Vol 1: Basic Architecture*, page 12-6, section 12.5.2, last paragraph currently states:

If the I/O bit map base address is greater than or equal to the TSS segment limit, there is no I/O permission map, and all I/O instructions generate exceptions when the CPL is greater than the current IOPL. The I/O bit map base address must be less than or equal to DFFFH.

It should state:

If the I/O bit map base address is greater than or equal to the TSS segment limit, there is no I/O permission map, and all I/O instructions generate exceptions when the CPL is greater than the current IOPL.

N19. Wrong Field Width for MINSS and MAXSS

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* section 3.2 under "MAXSS—Return Maximum Scalar Single-Precision Floating-Point Value" page 3-415 currently states:

DEST[63-0] .IF ((DEST[31-0] = 0.0) AND (SRC[31-0] = 0.0)) THEN SRC[31-0]

It should state:

DEST[31-0] .IF ((DEST[31-0] = 0.0) AND (SRC[31-0] = 0.0)) THEN SRC[31-0]

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* section 3.2 under "MINSS—Return Minimum Scalar Single-Precision floating-Point Value" page 3-428 currently states:

DEST[63-0] .IF ((DEST[31-0] = 0.0) AND (SRC[31-0] = 0.0)) THEN SRC[31-0]

It should state:

DEST[31-0] .IF ((DEST[31-0] = 0.0) AND (SRC[31-0] = 0.0)) THEN SRC[31-0]

N20. Figure 15-12 PEBS Record Format

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Section 15.9.6 "Programming the Performance Counters for Non-Retirement Events" page 15 - 37, Figure 15-12, first row currently states:



It should state:



N21. I/O Permission Bit Map

The *Intel Architecture Software Developer's Manual, Vol 1: Basic Architecture* Chapter 12, section 12.5.2 on Figure 12-2 (I/O Permission Bit Map) currently states:

Last byte of bit map must be followed by a byte with all bits.

It should state:

Last byte of bit map must be followed by a byte with all bits set.

Also, in the lower left hand Conner of Figure 12-2 (I/O Permission Bit Map) currently states:

Last I/O base map must be

It should state:

Last I/O base map must be less than or equal to DFFFH

N22. Cache Description

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Table 3-10, the "sectored, 64 byte line size" description is used for the following descriptors: 0x22, 0x23, 0x79, 0x7a, 0x7b, 0x7c. This description will change to "dual-sectored line, 64 byte sector size" for clarity.

N23. Instruction Formats and Encoding

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference*, Page B-8, CMOVcc memory to register should be encoded as "0000 1111 : 0100 tttt : mod reg r/m". Page B-8, CMP immediate with memory should be encoded as "1000 00sw : mod 111 r/m : immediate data". Page B-12 POP "segment register CS, DS, ES" should be encoded as "segment register DS, ES".

N24. Machine-Check Initialization

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* section 14.5 currently states:

14.5 MACHINE-CHECK INITIALIZATION

To use the processors machine-check architecture, software must initialize the processor to activate the machine-check exception and the error-reporting mechanism.

Example gives pseudocode for performing this initialization. This pseudocode checks for the existence of the machine-check architecture and exception on the processor, then enables the machine-check exception and the error-reporting register banks. The pseudocode assumes that the machine-check exception (#MC) handler has been installed on the system. This initialization procedure is compatible with the Pentium 4, Intel Xeon, P6 family, and Pentium processors.

Following power up or power cycling, the IA32_MCi_STATUS registers are not guaranteed to have valid data until after the registers are initially cleared to all 0s by software, as shown in the initialization pseudocode in Example .

Machine-Check Initialization Pseudocode

```
EXECUTE the CPUID instruction;
READ bits 7 (MCE) and 14 (MCA) of the EDX register;
IF CPU supports MCE
    THEN
        IF CPU supports MCA
            THEN
                IF IA32_MCG_CAP.MCG_CTL_P = 1
                    (* IA32_MCG_CTL register is present *)
                    IA32_MCG_CTL = FFFFFFFF;
                    (* enables all MCA features *)
                FI;
                COUNT = IA32_MCG_CAP.Count;
                MAX_BANK_NUMBER = COUNT - 1;
                (* determine number of error-reporting banks supported *)
                IF (P6 Family Processor)
                    THEN
                        FOR error-reporting banks (1 through MAX_BANK_NUMBER) DO
                            IA32_MCi_CTL = FFFFFFFF;
                            (* enables logging of all errors except for MC0_CTL register *)
                        OD
                    ELSE (* Pentium 4 and Intel Xeon Processors *)
                        FOR error-reporting banks (0 through MAX_BANK_NUMBER) DO
                            IA32_MCi_CTL = FFFFFFFF;
                            (* enables logging of all errors including MC0_CTL register *)
                        OD
                    FI;
                FOR error-reporting banks (0 through MAX_BANK_NUMBER) DO
                    IA32_MCi_STATUS = 0000000000000000H; (* clears all errors *)
                OD
            FI;
        Set the MCE flag (bit 6) in CR4 register to enable machine-check exceptions;
    FI;
```

It should state:

14.5 MACHINE-CHECK INITIALIZATION

To use the processors machine-check architecture, software must initialize the processor to activate the machine-check exception and the error-reporting mechanism.

Example gives pseudocode for performing this initialization. This pseudocode checks for the existence of the machine-check architecture and exception on the processor, then enables the machine-check exception and the error-reporting register banks. The pseudocode shown is compatible with the Pentium 4, Intel Xeon, P6 family, and Pentium processors.

Following power up or power cycling, the IA32_MCi_STATUS registers are not guaranteed to have valid data until after the registers are initially cleared to all 0s by software, as shown in the initialization pseudocode in Example . In addition, when using P6 family processors, the software must set MCI_STATUS registers to 0 when doing a soft-reset.

Machine-Check Initialization Pseudocode

```

Check CPUID Feature Flags for MCE and MCA support
IF CPU supports MCE
THEN
  IF CPU supports MCA
  THEN
    IF (IA32_MCG_CAP.MCG_CTL_P = 1)
    (* IA32_MCG_CTL register is present *)
    THEN
      IA32_MCG_CTL □ FFFFFFFF;
      (* enables all MCA features *)
    FI

    (* Determine number of error-reporting banks supported *)
    COUNT □ IA32_MCG_CAP.Count;
    MAX_BANK_NUMBER □ COUNT - 1;

    IF (Processor Family is 6H)
    THEN
      (* Enable logging of all errors except for MC0_CTL register *)
      FOR error-reporting banks (1 through MAX_BANK_NUMBER)
      DO
        IA32_MCi_CTL □ 0FFFFFFF;
      OD

      (* Clear all errors *)
      FOR error-reporting banks (0 through MAX_BANK_NUMBER)
      DO
        IA32_MCi_STATUS □ 0;
      OD

    ELSE IF (Processor Family is 0FH) (*any Processor Extended Family *)
    THEN
      (* Enable logging of all errors including MC0_CTL register *)
      FOR error-reporting banks (0 through MAX_BANK_NUMBER)

```

```

DO
    IA32_MCi_CTL □ 0FFFFFFFFFFFFFFFH;
OD

(* BIOS clears all errors only on power-on reset *)
IF (BIOS detects Power-on reset)
THEN
    FOR error-reporting banks (0 through MAX_BANK_NUMBER)
    DO
        IA32_MCi_STATUS □ 0;
    OD
ELSE
    FOR error-reporting banks (0 through MAX_BANK_NUMBER)
    DO
        (Optional for BIOS and OS) Log valid errors
        (OS only) IA32_MCi_STATUS □ 0;
    OD

FI

FI

FI

Setup the Machine Check Exception (#MC) handler for vector 18 in IDT

Set the MCE bit (bit 6) in CR4 register to enable Machine-Check Exceptions

FI

```

N25. Incorrect Description of MOVAPS #UD

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Section 3.2 "INSTRUCTION REFERENCE" MOVAPS #UD description is incorrect. Under Protected Mode Exceptions it currently states:

#UD If CPUID feature flag SSE2 is 0.

It should state:

#UD If CPUID feature flag SSE is 0.

Also, under Real-Address Mode Exceptions it currently states:

#UD If CPUID feature flag SSE2 is 0.

It should state:

#UD If CPUID feature flag SSE is 0.

N26. PSE-36 Paging Mechanism

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Chapter 5, Section 5.14, page 5-35 under "Interrupt 10 – Invalid TSS Exception (#TS)" the last paragraph of the description currently states:

To insure that a valid TSS is available to process the exception, the invalid TSS exception must be a task called using a task gate.

This wording is somewhat ambiguous and should be changed to:

The invalid-TSS handler must be a task called using a task gate. Handling this exception inside the faulting TSS context is not recommended and processor state may not be consistent.

N27. Segment Wraparound compatibility

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Chapter 18, Section 18.29.1. (Segment Wraparound) has the following paragraph added in the end of section:

The behavior when executing near the limit of a 4GB selector (limit=0xFFFFFFFF) is different between the Pentium Pro and the Pentium 4 family of processors. On the Pentium Pro, instructions which cross the limit -- for example, a two byte instruction such as INC EAX that is encoded as 0xFF 0xC0 starting exactly at the limit faults for a segment violation (a one byte instruction at 0xFFFFFFFF does not cause an exception). Using the Pentium 4 family, neither of these situations causes a fault.

N28. Performance Counting Clocks

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Chapter 15, Section 15.9.9 in Volume 3 (Counting Clocks) will be updated to clarify the impact of Intel Hyper-Threading Technology when considering clock ticks and the Time Stamp Counter. A number of updates have been integrated into the section.

N29. New Cascading Counters Chapter

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* chapter 15.9.6.6 will be updated to include information on extended cascading, a new feature included in the Intel NetBurst microarchitecture.

N30. Updated Table B-1 in Appendix B, Vol.3

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Appendix B, a new column will be added to Table B-1 "MSRs in the Pentium 4 and Intel Xeon Processors":

For Hyper-Threading Technology enabled processors, there are two logical processors per physical unit. If an MSR is Shared, this means that one MSR is shared between two logical processors. If an MSR is Unique, this means that each logical processor has its own MSR. The new column identifies the characteristics of each MSR

N31. Message Signaled Interrupts

In the *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* section 8.11, information will be added to include Message Signaled Interrupts, an optional feature that enables PCI devices to request service by writing a system-specified message to a system-specified address (PCI DWORD memory write transaction).

N32. Selecting Memory Types for Pentium 4, Intel Xeon, and Pentium III Processors

In the *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* chapter 10, Section 10.5.2.2, Table 10.7, Effective Page-Level Memory Types for Pentium III, Pentium 4, and Intel Xeon Processors currently states:

Table 10-7. Effective Page-Level Memory Types for Pentium III, Pentium 4, and Intel Xeon Processors

MTRR Memory Type	PAT Entry Value	Effective Memory Type
UC	X	UC ¹
WC	UC	UC ²
	UC-	WC
	WC	WC
	WT	Undefined
	WB	WC
	WP	Undefined
WT	UC	UC ²
	UC-	UC ²
	WC	WC
	WT	WT
	WB	WT
	WP	Undefined
WB	UC	UC ²
	UC-	UC ²
	WC	WC
	WT	WT
	WB	WB
	WP	WP
WP	UC	UC ²
	UC	Undefined
	WC	WC
	WT	Undefined
	WB	WP
	WP	WP

NOTES:

1. The UC attribute comes from the MTRRs and the processors are not required to snoop their caches since the data could never have been cached. This attribute is preferred for performance reasons.
2. The UC attribute came from the page-table or page-directory entry and processors are required to check their caches because the data may be cached due to page aliasing, which is not recommended.

It should state:

Table 10-7. Effective Page-Level Memory Types for Pentium III, Pentium 4, and Intel Xeon Processors

MTRR Memory Type	PAT Entry Value	Effective Memory Type
UC	UC	UC ¹
	UC-	UC ¹
	WC	WC
	WT	UC ¹
	WB	UC ¹
	WP	UC ¹
WC	UC	UC ²
	UC-	WC
	WC	WC
	WT	Undefined
	WB	WC
	WP	Undefined
WT	UC	UC ²
	UC-	UC ²
	WC	WC
	WT	WT
	WB	WT
	WP	Undefined
WB	UC	UC ²
	UC-	UC ²
	WC	WC
	WT	WT
	WB	WB
	WP	WP
WP	UC	UC ²
	UC-	Undefined
	WC	WC
	WT	Undefined
	WB	WP
	WP	WP

NOTES:

1. The UC attribute comes from the MTRRs and the processors are not required to snoop their caches since the data could never have been cached. This attribute is preferred for performance reasons.

2. The UC attribute came from the page-table or page-directory entry and processors are required to check their caches because the data may be cached due to page aliasing, which is not recommended.

N33. *Inaccurate Operation Description for Shift Instructions*

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Section 3.2 "Instruction Reference" Operation description for the SAL/SAR/SHL/SHR instruction is incorrect. It currently states:

```
(* Determine overflow for the various instructions *)
IF COUNT = 1
    THEN
        IF instruction is SAL or SHL
        ...
ELSE IF COUNT = 0
    THEN
        All flags remain unchanged;
```

It should state:

```
(* Determine overflow for the various instructions *)
IF (COUNT AND 1FH) = 1
    THEN
        IF instruction is SAL or SHL
        ...
ELSE IF (COUNT AND 1FH) = 0
    THEN
        All flags remain unchanged;
```

N34. *Documentation Changes to Support the Use of Hyper-Threading Technology*

The *Intel Architecture Software Developer's Manual, Vol 1: Basic Architecture* Chapter 2, and *Vol 3: System Programming Guide* Chapter 7:

Both chapters have been rewritten to include Hyper-Threading Technology terminology and descriptions.



N35. IRET/IRETD TASK-RETURN Block has Incorrect Exception Information

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Chapter 3, Section 3.2 "Instruction Reference" incorrectly describes the TASK-RETURN block of the OPERATION section of the IRET/IRETD instruction. It currently states:

IF local/global bit is set to local
OR index not within GDT limits

...

IF TSS descriptor type is not TSS or if the TSS is marked not busy
THEN #GP(TSS selector);

It should state:

IF local/global bit is set to local
OR index not within GDT limits

...

IF TSS descriptor type is not TSS or if the TSS is marked not busy
THEN #TS(TSS selector);

N36. LGDT Exception Listing in Virtual-8086

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Chapter 3, Section 3.2 "Instruction Reference" incomplete listing of LGDT/LIDT in Virtual-8086 Mode Exceptions. It currently states:

Virtual-8086 Mode Exceptions

#GP(0) The LGDT and LIDT instructions are not recognized in virtual-8086 mode.

It should state:

Virtual-8086 Mode Exceptions

#GP(0) The LGDT and LIDT instructions are not recognized in virtual-8086 mode.

#GP If the current privilege level is not 0.

N37. Various Table B-22 Errors and Omissions

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* APPENDIX B, Section B.7 "Floating-point Instruction Formats and Encoding" various errors and omission in Table B-22. It currently states:

FICOMP-Compare Integer and Pop

16-bit memory

32-bit memory

FIDIV

$ST(0) \leftarrow ST(0) \div 16\text{-bit memory}$

$ST(0) \leftarrow ST(0) \div 32\text{-bit memory}$

FIDIVR

$ST(0) \leftarrow ST(0) \div 16\text{-bit memory}$

$ST(0) \leftarrow ST(0) \div 32\text{-bit memory}$

.

.

.

FIMUL

$ST(0) \leftarrow ST(0) \times 16\text{-bit memory}$

$ST(0) \leftarrow ST(0) \times 32\text{-bit memory}$

.

.

.

FISUB

$ST(0) \leftarrow ST(0) - 16\text{-bit memory}$

$ST(0) \leftarrow ST(0) - 32\text{-bit memory}$

FISUBR

$ST(0) \leftarrow ST(0) - 16\text{-bit memory}$

$ST(0) \leftarrow ST(0) - 32\text{-bit memory}$

.

.

.

FMULP – Multiply

$ST(0) \leftarrow ST(0) \times ST(i)$

.

.

.

It should state:

FICOMP-Compare Integer and Pop

16-bit memory

32-bit memory

FIDIV

$ST(0) \leftarrow ST(0) \div 16\text{-bit memory}$

$ST(0) \leftarrow ST(0) \div 32\text{-bit memory}$

FIDIVR

$ST(0) \leftarrow 16\text{-bit memory} \div ST(0)$

$ST(0) \leftarrow 32\text{-bit memory} \div ST(0)$

.

.

.

FIMUL

$ST(0) \leftarrow ST(0) \times 16\text{-bit memory}$

$ST(0) \leftarrow ST(0) \times 32\text{-bit memory}$

.

.

.

FISUB
 $ST(0) \leftarrow ST(0) - 16\text{-bit memory}$
 $ST(0) \leftarrow ST(0) - 32\text{-bit memory}$
FISUBR
 $ST(0) \leftarrow 16\text{-bit memory} - ST(0)$
 $ST(0) \leftarrow 32\text{-bit memory} - ST(0)$

.

.

.

FMULP – Multiply
 $ST(i) \leftarrow ST(0) \times ST(i)$

.

.

.

N38. Misreporting of Exceptions for MOVDQA

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Section 3.2, Instruction Reference, under MOVDQA currently states:

Protected Mode Exceptions

#GP(0) If a memory operand effective address is outside the CS, DS, ES, FS, or GS segment limit.

If memory operand is not aligned on a 16-byte boundary, regardless of segment.

#SS(0) If a memory operand effective address is outside the SS segment limit.

#NM If TS in CR0 is set.

#UD If EM in CR0 is set.

If OSFXSR in CR4 is 0.

Real-Address Mode Exceptions

#PF(fault-code) If a page fault occurs.

#GP(0) If memory operand is not aligned on a 16-byte boundary, regardless of segment.

If any part of the operand lies outside of the effective address space from 0 to FFFFH.

#NM If TS in CR0 is set.

#UD If EM in CR0 is set.

If OSFXSR in CR4 is 0.

It should state:

Protected Mode Exceptions

#PF(fault-code) If a page fault occurs.

#GP(0) If a memory operand effective address is outside the CS, DS, ES, FS, or GS segment limit.

If memory operand is not aligned on a 16-byte boundary, regardless of segment.

#SS(0) If a memory operand effective address is outside the SS segment limit.

#NM If TS in CR0 is set.

#UD If EM in CR0 is set.

If OSFXSR in CR4 is 0.

Real-Address Mode Exceptions

#GP(0) If memory operand is not aligned on a 16-byte boundary, regardless of segment.

#NM If any part of the operand lies outside of the effective address space from 0 to FFFFH.
 #UD If TS in CR0 is set.
 If EM in CR0 is set.
 If OSFXSR in CR4 is 0.

N39. Effect of STI on NMI

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Section 3.2, Instruction Reference, under STI-Set Interrupt Flag currently states:

The IF flag and the STI and CLI instructions have no affect on the generation of exceptions and NMI interrupts.

It should state:

The IF flag and the STI and CLI instructions have no affect on the generation of exceptions. NMI interrupts may be blocked for one macroinstruction following an STI.

N40. 133 MHz PSB Encoding in MSR_EBC_FREQUENCY_ID Register

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Appendix B, Table B-1, the MSR_EBC_FREQUENCY_ID register bits [18:16] currently states:

2CH	44	MSR_EBC_FREQUENCY_ID	Shared	Processor Frequency Configuration. (R) Indicates current processor frequency configuration.						
		20:0		Reserved.						
		18:16		Scalable Bus Speed. (R/W) Indicates the intended scalable bus speed:						
				<table><tr><td><u>Encoding</u></td><td><u>Scalable Bus Speed</u></td></tr><tr><td>000B</td><td>100 MHz</td></tr><tr><td>All Others</td><td>Reserved</td></tr></table>	<u>Encoding</u>	<u>Scalable Bus Speed</u>	000B	100 MHz	All Others	Reserved
<u>Encoding</u>	<u>Scalable Bus Speed</u>									
000B	100 MHz									
All Others	Reserved									
		63:24		Reserved.						

It should state:

2CH	44	MSR_EBC FREQUENCY_ID	Shared	<p>Processor Frequency Configuration. The bit field layout of this MSR varies according to the MODEL value of the CPUID version information. The following bit field layout applies to Pentium 4 and Xeon Processors with MODEL encoding equal or greater than 2. (R) Indicates current processor frequency configuration.</p> <p>Reserved.</p> <p>Scalable Bus Speed. (R/W) Indicates the intended scalable bus speed:</p> <table><tr><td><u>Encoding</u></td><td><u>Scalable Bus Speed</u></td></tr><tr><td>000B</td><td>100 MHz</td></tr><tr><td>001B</td><td>133 MHz</td></tr></table> <p>(The actual value of 133.33MHz should be utilized if performing calculation with System Bus Speed, when encoding is 001B.) All Others Reserved</p> <p>Reserved.</p>	<u>Encoding</u>	<u>Scalable Bus Speed</u>	000B	100 MHz	001B	133 MHz
<u>Encoding</u>	<u>Scalable Bus Speed</u>									
000B	100 MHz									
001B	133 MHz									
		15:0								
		18:16								
		63:29								

N41. Double Fault Exception

The *Intel Architecture Software Developer's Manual, Vol 3: System Programming Guide* Chapter 5, Section 5.12 "Exception and Interrupt Reference" Interrupt 8 - Double Fault Exception (#DF), the double fault handler description currently states:

If the shutdown occurs while the processor is executing an NMI interrupt handler, then only a hardware reset can restart the processor.

It should state:

If the shutdown occurs while the processor is executing an NMI interrupt handler, then only a hardware reset can restart the processor. Likewise, if the shutdown occurs while executing in SMM, a hardware reset should be used to restart the processor.

N42. Move To/From Control Registers

The *Intel Architecture Software Developer's Manual, Vol 2: Instruction Set Reference* Section 3.2 "Instruction Reference" Operation description for the Move to/from Control Register instruction is incorrect. It currently states:

When loading a control register, a program should not attempt to change any of the reserved bits; that is, always set reserved bits to the value previously read.

It should state:

If a load of CR4 would set any of its reserved bits, a general-protection fault occurs. The reserved bits in CR0 and CR3 remain clear after any load of those registers, although attempts to set such bits do not cause faults. On Intel Pentium 4, Intel Xeon, and P6 family processors, CR0.ET remains set after any load of CR0, although attempts to clear it do not cause faults. When loading a control register, a program should always set reserved bits to the value previously read.

SPECIFICATION CLARIFICATIONS

The Specification Clarifications listed in this section apply to the following documents:

- *Intel Architecture Software Developer's Manual, Volumes 1, 2, and 3*
- *Intel® Pentium® 4 Processor in the 423-pin Package* datasheet
- *Intel® Pentium® 4 Processor in the 478-pin Package* datasheet
- *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet

All Specification Clarifications will be incorporated into a future version of the appropriate Intel Pentium 4 processor documentation.

N1. Clarifying DBI# Definition for all Processors With Intel® NetBurst™ Micro-architecture

The definition of DBI# signals will be clarified for Intel(R) Pentium(R) 4 Processors with Intel® NetBurst™ Micro-architecture. The new definition will state:

DBI[3:0]# are source synchronous and indicate the polarity of the D[63:0]# signals. The DBI[3:0]# signals are activated when the data on the data bus is inverted. If more than half of the data bits, within a 16-bit group, would have been asserted electrically low, the bus agent may invert the data bus signals for that particular sub-phase for that 16-bit group.

SPECIFICATION CHANGES

The Specification Changes listed in this section apply to the following documents:

- *Intel Architecture Software Developer's Manual, Volumes 1, 2, and 3*
- *Intel® Pentium® 4 Processor in the 423-pin Package* datasheet
- *Intel® Pentium® 4 Processor in the 478-pin Package* datasheet
- *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet

All Specification Changes will be incorporated into a future version of the appropriate Intel Pentium 4 processor documentation.

N1. PWRGOOD Specification Changes

The following changes will be made to the *Intel® Pentium® 4 Processor in the 423-pin Package*, *Intel® Pentium® 4 Processor in the 478-pin Package*, and *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet (Note that table and figure numbers refer to the *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet. The corresponding tables and figures will be updated in the other documents):

In the Systems Bus Pin Groups table (table 4) PWRGOOD will be moved from the Asynchronous GTL+ Input group to the Power/Other group.

In the Chapter 2 section titled 'Asynchronous GTL+ Signals' PWRGOOD will be removed from the list of signals.

In Chapter 5, the Signal Buffer Type of PWRGOOD will change from Asynch GTL+ to Power/Other (in both table 34 and 35).

Table 12 will be renamed to 'PWRGOOD and TAP Signal Group DC Specifications.'

TAP will be removed from the descriptions of the VHYS, VT+, and VT- parameters in table 12.

Table 14 will be renamed to 'Miscellaneous Signals AC Specifications.'

Timing T35 will have ', except PWRGOOD' removed from the parameter description.

Note 2 to table 14 will have the following sentence added: 'PWRGOOD is referenced to the BCLK0 rising edge at 0.5 * VCC.'

Table 25 will be renamed to 'Ringback Specifications for PWRGOOD and TAP Signal Groups.'

The Signal Groups rows of table 25 will change to read: 'TAP and PWRGOOD.'

Figure 23 will be renamed to 'Low-to-High System Bus Receiver Ringback Tolerance for PWRGOOD and TAP Buffers.'

Figure 24 will be renamed to 'High-to-Low System Bus Receiver Ringback Tolerance for PWRGOOD and TAP Buffers.'

Table 29 will be renamed to 'Asynchronous GTL+, PWRGOOD, and TAP Signal Groups Overshoot/Undershoot Tolerance.'

N2. PROCHOT# Pulse Width Specification Change

The minimum PROCHOT# Pulse Width Specification (T38) in Table 17 (Asynchronous GTL+ Signals AC Specifications) of the *Intel® Pentium® 4 Processor with 512KB L2 Cache on .13 Micron Process* datasheet currently states:

T# Parameter	Min	Max	Unit	Figure	Note
T38: PROCHOT# Pulse Width	TBD		μs	18	5

It should state:

T# Parameter	Min	Max	Unit	Figure	Note
T38: PROCHOT# Pulse Width	500		μs	18	5

N3.**Context ID feature added to the CPUID Instruction Feature Flags/IA32_MISC_ENABLE Registers**

IA32_MISC_ENABLE register, bit 24 status has change from Reserved to the following definition:

IA32_MISC_ENABLE – Miscellaneous Enables Register, bit # 24

MSR Address: 01A0h Accessed as a Qword
 Default Value: High Dword XXXX XXXXh
 Low Dword XXXX XXXX XXXX XXXX XXXX XX00 X0X0 0001b
 Access: Read/Write
 Type: Shared

IA32_MISC_ENABLE is a 64-bit register accessed only when referenced as a Qword through a RDMSR or WRMSR instruction.

Bit 24 of the IA32_MISC_ENABLE status has change from Reserved to the following:

Bit	Descriptions
24	L1 Data Cache Context Mode (R/W). When set to a '1' this bit places the L1 Data Cache into shared mode. When set to a '0' (default) this bit places the L1 Data Cache into adaptive mode. When this bit is set to a '0', adaptive mode, the Page Directory Base Register contained in CR3 must be identical across all logical processors. Note: If the Context ID feature flag, ECX[10], is not set to a '1' after executing CPUID Instruction with EAX = 1, then this feature is not supported and BIOS must not alter the contents of this bit location.

In the CPUID Instruction function 1 feature information, bit 10 of ECX register (ECX[10]) has been assigned flag to identify "Context ID feature". The status has changed from Reserved to the following:

ECX [Bits]	Descriptions of Feature Flag Value
10	Context ID. A value of 1 indicates the L1 data cache mode can be set to either adaptive mode or shared mode. A value of 0 indicates this feature is not supported. See definition of the IA32_MISC_ENABLE MSR Bit 24 (L1 Data Cache Context Mode) for more details.

N4. Multiple VID Specifications

The Intel(R) Pentium(R) 4 with 512KB L2 Cache on .13 Micron Process Electrical, Mechanical, and Thermal Specifications (Rev. 2.3) and Intel(R) Pentium(R) 4 with 512-KB L2 Cache on .13 Micron Process Datasheet will incorporate the following for multiple VID specifications.

Following Note will be added to the EMTS Table 9 and the Datasheet Table 7, Voltage and Current Specifications:

Note: Icc_max is specified for highest VID only. Processor will be shipped under multiple VIDs listed for each frequency, however the Icc_max specifications will be same as highest VID specified in the table.

Following Note will be added to the EMTS Table 59 and the Datasheet Table 22, Processor Thermal Design Power:

Note: TDP and Tcase are specified for highest VID only. Processor will be shipped under multiple VIDs for each frequency, however the TDP and Tcase specifications will be same as highest VID specified in the table.

The following are the voltage, current and power specifications for multiple VID. There are no increases made to the power specifications.

VID=1.525V									
Frequency (GHz)	2	2.20	2.26	2.40	2.50	2.53	2.60	2.66	2.80
Vmax	1.440	1.435	1.435	1.430	1.430	1.430	1.425	1.420	1.420
Vmin	1.365	1.360	1.355	1.350	1.350	1.350	1.345	1.345	1.340
Icc_total @Vmax	45.1 A	47.9 A	48.6 A	50.7 A	52.5 A	52.5 A	53.5 A	53.9 A	55.9 A
TDP	54.3 W	57.1 W	58.0 W	59.8 W	61.0W	61.5 W	62.6 W	66.1 W	68.4 W
Tcase	69 C	70 C	70 C	71 C	72 C	72 C	72 C	74 C	75 C
Icc Stop Grant	23A								

VID = 1.500V									
Freq (GHz)	2	2.20	2.26	2.40	2.50	2.53	2.60	2.66	2.80
Vmax	1.415	1.410	1.405	1.405	1.400	1.400	1.400	1.395	1.395
Vmin	1.340	1.335	1.330	1.330	1.325	1.325	1.320	1.320	1.315

VID = 1.475V									
Freq (GHz)	2	2.20	2.26	2.40	2.50	2.53	2.60	2.66	2.80
Vmax	1.390	1.385	1.380	1.380	1.375	1.375	1.375	1.370	1.370
Vmin	1.315	1.310	1.305	1.300	1.300	1.295	1.295	1.295	1.290

VID=1.550	
Frequency (GHz)	3.06
Vmax	1.425
Vmin	1.340
Icc_max @Vmax	65.4 A
TDP	81.8 W
Tcase	69 C
Icc Stop Grant	27.0 A

VID (Freq=3.06 GHz)	1.525	1.500	1.475
Vmax	1.395	1.370	1.345
Vmin	1.315	1.290	1.265